

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

.. OF COPIES RECEIVED

DISTRIBUTION

SANTA FE

FILE

U.S.G.S.

LAND OFFICE

OPERATOR

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE APPLICATION FOR PERMIT L-1 (FORM C-101) FOR SUCH PROPOSALS.)

5a. Indicate Type of Lease

State ☐Fee ☐

5. State Oil & Gas Lease No.

7. Unit Agreement Name

8. Farm or Lease Name

R. G. Mills

9. Well No.

1 1

10. Field and Pool, or Wildcat

Allison Abo & Penn

12. County

Lea

15. Elevation (Show whether DF, RT, GR, etc.)

4073 RT

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐TEMPORARILY ABANDON ☐PULL OR ALTER CASING ☐OTHER ☐PLUG AND ABANDON ☒REMEDIAL WORK ☐COMMENCE DRILLING OPNS. ☐CASING TEST AND CEMENT JOB ☐OTHER ☐ALTERING CASING ☐PLUG AND ABANDONMENT ☐

COMMISSION MUST BE NOTIFIED 24
HOURS PRIOR TO THE BEGINNING OF
PLUGGING OPERATIONS FOR THE C-103
TO BE APPROVED.

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU Pulling Unit. Install BOP.
2. Pull rods and tubing.

USE CLASS "H" CEMENT AND 9.5# MUD BETWEEN
ALL PLUGS.

3. Rig up Go International. Set GO Elite 5-1/2" CIBP @ 9700'. Dump 10³⁵ cement on BP. Seat a second 5-1/2" Elite CIBP at 8970. Dump 10³⁵ cement on BP. Stretch 5-1/2" casing. Run free point. Shoot and pull 5-1/2" casing. Expect 5000' recovery.
4. Run tubing to 8950. Circulate hole w/9.5# mud. Pull up and spot 40 sx cement plug 50' in and out of 5-1/2" casing stub.
5. Pull up and spot 50 sx cement plug 50' in and out of 8-5/8" casing seat. POH.
6. Run free point. Shoot and pull 8-5/8" casing.
7. Run tubing, spot 80 sx. cement plug 50' in and out of 8-5/8" casing stub.
8. Spot 110 sx cement plug 50' in and out of 13-3/8" casing seat. Spot 20 sx. cement plug at surface.
9. Weld on cap and install permanent marker. Clean location.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED

TITLE

Proration Analyst

DATE

3-16-76

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: