

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLI
(Other instructions
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

NM 34445

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1.

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. NAME OF OPERATOR

LAYTON ENTERPRISES, INC.

3. ADDRESS OF OPERATOR

3103 79TH ST. LUBBOCK, TEXAS 79423

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*

See also space 17 below.)

At surface

660' FNL 660' FNL
SEC 18, T9S, R36E
LEA COUNTY, NEW MEXICO

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

DAVIS FEDERAL

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

ROUGH PERMO PENN

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

18-9-36

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

4109 DF

12. COUNTY OR PARISH

LEA

13. STATE

NM

U. S. GEOLOGICAL SURVEY

1. HOBBS, NEW MEXICO Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

REPAIRING WELL

FRACTURE TREATMENT

ALTERING CASING

SHOOTING OR ACIDIZING

ABANDONMENT*

(Other)

(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

DATE(S) OF WORK NOT ESTABLISHED - WILL NOTIFY 48 HOURS
PRIOR TO COMMENCEMENT.

INTEND TO PLUG & ABANDON WELL AS FOLLOWS:

1. SET CAST IRON BRIDGE PLUG @ 9600' WITH 50' CEMENT PLUG ON TOP.
2. CUT & PULL 5 1/2" CASING FROM FREE POINT.
3. SPOT 50 SK CEMENT PLUG IN AND OUT OF 5 1/2" STUB.
4. SPOT 50 SK PLUG ACROSS 8 5/8" CASING SHOE @ 4213.
5. CUT & PULL 8 5/8" CASING FROM 300' (TOP OF CEMENT).
6. SPOT 75 SK PLUG IN AND OUT OF 8 5/8" STUB @ 300'.
7. SPOT 10 SK PLUG AT SURFACE & SET MARKER.
8. CLEAR & LEVEL LOCATION AND PITS - WILL LEAVE
CALICHE PAD INTACT AT REQUEST OF SURFACE OWNER.

NOTE: HOLE WILL BE FILLED WITH MUD LADEN FLUID BETWEEN PLUGS

18. I hereby certify that the foregoing is true and correct

SIGNED

Donald R. Lipton

TITLE

PRESIDENT

DATE

8-11-80

(This space for Federal or State office use)

APPROVED BY

Sgt. GEORGE H. STEIN

TITLE

Sgt. PATRICK ANCHUT

DATE

8-11-80

CONDITIONS OF APPROVAL, IF ANY: