- Submit 3 Copies to Appropriate District Office	Energ	ew Mexico ural Resources Department		Form C-103 Revised 1-1-89
District Office DISTRICT I P.O. Box 1980, Hobbs, NM 88240	PO B	TION DIVISION ox 2088	WELL API NO. 30-02	5-20388
DISTRICT II P.O. Drawer DD, Artesia, NM 88210 Santa Fe, New Mexico 87504-2088		5. Indicate Type of Les	STATE FEE	
DISTRICT III 1000 Rio Brazos Rd., Azisc, NM 87410			6. State Oil & Gas Las VO	== Na. -5490
(DO NOT USE THIS FORM FOR	OTICES AND REPORTS O PROPOSALS TO DRILL OR TO D ESERVOIR. USE "APPLICATION I IM C-101) FOR SUCH PROPOSAL	FOR PERMIT	7. Lesse Name or Unit	a Agreement Name
1. Type of Well: OL GAS WELL WELL			Carper McAles	ster ATE State
A March of Complete				1
YATES PETROLEUM COR	PORATION		9. Pool same or Wild	cat
3. Address of Operator 105 South 4th St.,	Artesia, NM 88210		Wildcat	
4. Well Location	660 Feet From The Nor	th Line and 16	50 Feet From Th	West Line
25	Township 115	Range 34E	NMPM	Lea County
	10. Elevation (Short	w whether DF, RKB, RT, GR, etc.) 4144' GR		
	eck Appropriate Box to In	dicate Nature of Notice.	Report, or Other I	Data
11. Ch			BSEQUENT RE	PORT OF:
	FINTENTION IU:	00		
PERFORM REMEDIAL WORK				
PERFORM REMEDIAL WORK		N REMEDIAL WORK	ING OPNS. P	LTERING CASING
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING	PLUG AND ABANDON CHANGE PLANS	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor	ING OPNS. CEMENT JOB ate, acidize &	LTERING CASING
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING	PLUG AND ABANDON CHANGE PLANS	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor	ING OPNS. CEMENT JOB ate, acidize &	LTERING CASING
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER:	PLUG AND ABANDON CHANGE PLANS d Operations (Clearly state all periment	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor Met details, and give pertinent dates, in	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s	LTERING CASING
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12. Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned	PLUG AND ABANDON CHANGE PLANS	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor Metadails, and give pertinent dates, in chors. Moved in pul	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit.	LTERING CASING
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12. Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install	PLUG AND ABANDON CHANGE PLANS	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor Me details, and give pertinent dates, in chorş. Moved in pul ed up pulling unit.	ANG OPNS. A CEMENT JOB ate, acidize & actuding estimated date of s ling unit.	LTERING CASING
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi	PLUG AND ABANDON CHANGE PLANS	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor Metails, and give pertinent dates, in chors. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'.	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7-	LTERING CASING
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul	PLUG AND ABANDON CHANGE PLANS	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor M details, and give pertinent dates, in chors. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in.	ANG OPNS. P CEMENT JOB ate, acidize & ate, acidize	LTERING CASING
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12. Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit	PLUG AND ABANDON CHANGE PLANS Operations (Clearly state all perimer location and set and ed tubinghead. Rigge h bit, scraper and tu nt and ran in 15'. S ic BOP. TOOH. Shut h bit, drill collars	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor Me details, and give pertinent dates, in chors. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in. and tubing. Cleane	ANG OPNS. P CEMENT JOB ate, acidize & ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7- ed out cement f	LTERING CASING LUG AND ABANDONMENT
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12. Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d	PLUG AND ABANDON CHANGE PLANS CHANGE PLANS Operations (Clearly state all perimer location and set and ed tubinghead. Rigge h bit, scraper and tu nt and ran in 15'. S ic BOP. TOOH. Shut h bit, drill collars TOOH. Rigged up wi tools and rigged dow iry. Shut well in.	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor M details, and give pertinent dates, in chors. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in. and tubing. Cleane reline. TIH with loo m wireline. TIH with	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7- ed out cement fogging tools and th tubing open	LTERING CASING LUG AND ABANDONMENT
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Completent work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH witt Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH witt Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wit	PLUG AND ABANDON CHANGE PLANS CHANGE Change Change Change Change Change C	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor of details, and give pertinent dates, in chors. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in. and tubing. Cleane reline. TIH with loo m wireline. TIH with loo	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7- ed out cement f ogging tools and th tubing open 1 lubricator. ed 12197-12228	LTERING CASING LUG AND ABANDONMENT frac frac in. Fell thru. 1/16" 5K valve, rom 12138-12290'. id ran GR/CBL log. ended to 10000' Tested to 3500 w/84 .42" holes
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install. 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wi psi. TIH with 3-3	PLUG AND ABANDON CHANGE PLANS CHANGE	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor m details, and give pertinent dates, in chorş. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in. and tubing. Cleane reline. TIH with log wireline with ful up wireline with ful use and perforat. 228' (6 SPF - Morror)	ANG OPNS. P CEMENT JOB ate, acidize & ate, acidize	LTERING CASING LUG AND ABANDONMENT frac frac frac in. Fell thru. 1/16" 5K valve, rom 12138-12290'. id ran GR/CBL log. ended to 10000' Tested to 3500 w/84 .42" holes
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wi psi. TIH with 3-3 as follows: 12197	PLUG AND ABANDON CHANGE PLANS CHANGE PLANS	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor of details, and give pertinent dates, in chors. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in. and tubing. Cleane reline. TIH with lo m wireline. TIH with lo m wireline. TIH with lo m wireline. TIH with lo m wireline with full agguns and perforat. 228' (6 SPF - Morror	ANG OPNS. P CEMENT JOB ate, acidize & ate,	LTERING CASING LUG AND ABANDONMENT
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wi psi. TIH with 3-3 as follows: 12197 down wireline and 10-24-25-997 - Blea	PLUG AND ABANDON CHANGE PLANS CHANGE	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor M details, and give pertinent dates, in chors. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in. and tubing. Cleane reline. TIH with lo m wireline. TIH with lo m wireline. TIH with log guns and perforat. 228' (6 SPF - Morror ested. Shut well in ch packer and tubing	ANG OPNS. P CEMENT JOB ate, acidize & ate,	LTERING CASING LUG AND ABANDONMENT frac frac frac in. Fell thru. 1/16" 5K valve, rom 12138-12290'. id ran GR/CBL log. ended to 10000' Tested to 3500 w/84 .42" holes guns and rigged at 12130'. Nippled
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wi psi. TIH with 3-3 as follows: 12197 down wireline and 10-24-25-997 - Blea	PLUG AND ABANDON CHANGE PLANS CHANGE PLANS	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor rdetails, and give pertinent dates, in chorş. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in. and tubing. Cleane reline. TIH with low wireline with full up wireline with full uses and perforate 228' 6 SPF - Morror ested. Shut well in charter and tubing	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7- ed out cement f ogging tools and th tubing open l lubricator. ed 12197-12228 w). TOOH with Set packer a CONTINUED ON	LTERING CASING LUG AND ABANDONMENT frac frac frac in. Fell thru. 1/16" 5K valve, rom 12138-12290'. id ran GR/CBL log. ended to 10000' Tested to 3500 w/84 .42" holes guns and rigged at 12130'. Nippled
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wi psi. TIH with 3-3 as follows: 12197 down wireline and 10-24-25-997 - Bleat I bereby certify the the information at SHOMATURE	PLUG AND ABANDON CHANGE PLANS CHANGE CHANS CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHA	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor M details, and give pertinent dates, in chors. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in. and tubing. Cleane reline. TIH with lo m wireline. TIH with lo m wireline. TIH with log guns and perforat. 228' (6 SPF - Morror ested. Shut well in ch packer and tubing	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7- ed out cement f ogging tools and th tubing open l lubricator. ed 12197-12228 w). TOOH with Set packer a CONTINUED ON	LTERING CASING LUG AND ABANDONMENT frac frac frac frac in. Fell thru. 1/16" 5K valve, rom 12138-12290'. id ran GR/CBL log. ended to 10000' Tested to 3500 w/84 .42" holes guns and rigged at 12130'. Nippled N NEXT PAGE:
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wi psi. TIH with 3-3 as follows: 12197 down wireline and 10-24-25-997 - Bleat I bereby certify the the information at SHOMATURE	PLUG AND ABANDON CHANGE PLANS CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor rdetails, and give pertinent dates, in chorş. Moved in pul ed up pulling unit. ubing. Tagged up wi Set down at 12138'. well in. and tubing. Cleane reline. TIH with low wireline with full up wireline with full uses and perforate 228' 6 SPF - Morror ested. Shut well in charter and tubing	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7- ed out cement f ogging tools and th tubing open l lubricator. ed 12197-12228 w). TOOH with Set packer a CONTINUED ON	LTERING CASING LUG AND ABANDONMENT frac
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12. Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install. 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wi psi. TIH with 3-3 as follows: 12197 down wireline and 10-24-25-997 - Bleck I bereby certify the dis information at stonatures TYPE OR FRENT NAME Rusty (This space for State Use)	PLUG AND ABANDON CHANGE PLANS CHANGE CHANGE	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor Moved in pulling eduaids, and give pertinent dates, in chorş. Moved in pulling eduaids, and give pertinent dates, in chorş. Moved in pulling eduaids, and give pertinent dates, in chorş. Moved in pulling eduay pulling unit. ubing. Tagged up wit Set down at 12138'. well in. and tubing. reline. TIH with log m wireline. up wireline with fulling up wireline with fulling up wireline with fulling moviedge and belief.	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7- ed out cement f ogging tools and th tubing open l lubricator. ed 12197-12228 w). TOOH with Set packer a CONTINUED ON	LTERING CASING LUG AND ABANDONMENT frac
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12. Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install. 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wi psi. TIH with 3-3 as follows: 12197 down wireline and 10-24-25-997 - Bleck I bereby certify the dis information at stonatures TYPE OR FRENT NAME Rusty (This space for State Use)	PLUG AND ABANDON CHANGE PLANS CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE CHANGE C	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor Moved in pulling eduaids, and give pertinent dates, in chorş. Moved in pulling eduaids, and give pertinent dates, in chorş. Moved in pulling eduaids, and give pertinent dates, in chorş. Moved in pulling eduay pulling unit. ubing. Tagged up wit Set down at 12138'. well in. and tubing. cleane reline. TIH with low up wireline with fulling up wireline with fulling up wireline with fulling the packer and tubing the packer and tubing the packer and tubing	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7- ed out cement f ogging tools and th tubing open l lubricator. ed 12197-12228 w). TOOH with Set packer a CONTINUED ON	LTERING CASING LUG AND ABANDONMENT frac from 12138-12290'. from 12138-12290'. from 12138-12290'. frac
PERFORM REMEDIAL WORK TEMPORARILY ABANDON PULL OR ALTER CASING OTHER: 12 Describe Proposed or Complete work) SEE RULE 1103. 10-19-99 - Cleaned 10-20-99 - Install 10-21-99 - TIH wit Picked up next joi 7-1/16" 5K hydraul 10-22-99 - TIH wit Circulated clean. TOOH with logging and swabbed hole d 10-23-99 - TOOH wi psi. TIH with 3-3 as follows: 12197 down wireline and 10-24-25-997 - Blec I bereby cartify the desinformation at SONATURE RULE TYPE OR FRENT NAME CHICIN A	PLUG AND ABANDON CHANGE PLANS CHANGE AND SET OF CHAINES CONTRICT I SUPERVISOR	N REMEDIAL WORK COMMENCE DRILLI CASING TEST AND OTHER: Perfor Moved in pulling eduaids, and give pertinent dates, in chorş. Moved in pulling eduaids, and give pertinent dates, in chorş. Moved in pulling eduaids, and give pertinent dates, in chorş. Moved in pulling eduay pulling unit. ubing. Tagged up wit Set down at 12138'. well in. and tubing. reline. TIH with log m wireline. up wireline with fulling up wireline with fulling up wireline with fulling moviedge and belief.	ANG OPNS. P CEMENT JOB ate, acidize & actuding estimated date of s ling unit. th 381 joints Nippled up 7- ed out cement f ogging tools and th tubing open l lubricator. ed 12197-12228 w). TOOH with Set packer a CONTINUED ON	LTERING CASING LUG AND ABANDONMENT frac from 12138-12290'. from 12138-12290'. from 12138-12290'. frac

-