

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PRODUCE TO BE LIFTED OR TO BE OPENED OR PLUG BACK TO A DIFFERENT RESERVOIR. USE APPLICATION FOR REPORT ON (WELLS) CANCELLED FOR OTHER PURPOSES.)		5a. Indicate Type of Lease State ☐ Fee ☒ 5. State Oil & Gas Lease No.
1. ☐ OIL WELL ☐ GAS WELL ☐ OTHER- <u>Plugged and Abandoned</u>		7. Unit Agreement Name
2. Name of Operator <u>Southland Royalty Company</u>		8. Farm or Lease Name <u>Farrar "A"</u>
3. Address of Operator <u>21 Desta Drive, Midland, Texas 79705</u>		9. Well No. <u>1</u>
4. Location of Well UNIT LETTER <u>A</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>810</u> FEET FROM <u>East</u> THE LINE, SECTION <u>13</u> TOWNSHIP <u>11S</u> RANGE <u>33E</u> NMPM.		10. Field and Pool, or Wildcat <u>Irbe-Permo (Penn)</u>
11. Elevation (Show whether DF, RT, GR, etc.) <u>4202' GR</u>		12. County <u>Lea</u>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. MIRU 8-15-84. POH & LD rods.
2. GIH w/tbg. POH w/tbg. RIH & set CIBP @ 9440'. GIH w/tbg.
3. Displ hole w/10# brine gel. Spot 35' cmt on top of CIBP @ 9440'. POH & LD tbg.
4. Remove WH. Welded on pull nipple. Installed csg jacks. Ran free pt. Free pt @ 4600'. Shot off 5 1/2" csg @ 4500'. LD & RD jacks.
5. RIH & spot 100' cmt @ 4550'. POH.
6. Tag cmt plug @ 4375'. Pulled to 4020' & spot 45 sx. WOC 4 hrs. Tag plug @ 3985'. Spot add'l 35 sx @ 3985'. POH w/tbg.
7. Run free pt on 8 5/8" csg. Tag plug @ 3867'. POH & LD tbg. Cut off WH. Weld pull nipple on 8 5/8" csg & RU csg jacks.
8. Free pt on 8 5/8" csg @ 1000'. Shot 8 5/8" csg @ 1000'. RIH w/tbg & spot 60 sx cmt @ 1050'. POH.
9. Well plugged and abandoned 8-24-84. GIH w/tbg. Tag cmt @ 925'. TOH w/tbg to 415'. Spot 90 sx cmt plug. Tag plug @ 309'. TOH w/tbg. Spot 10 sx plug @ surface. RDCU. Clean out. Weld on plate marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED John Stark TITLE Operations Engineer DATE 8/29/84

APPROVED BY Ronald M. Callenberg TITLE OIL & GAS INSPECTOR DATE FEB 18 1985

CONDITIONS OF APPROVAL, IF ANY: