

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
310 Old Santa Fe Trail, Room 206
Santa Fe, New Mexico 87503

WELL API NO. 30-025-21954
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Bell "B"
8. Well No. 1
9. Pool name or Wildcat North Bagley (Permo Penn)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER	
2. Name of Operator Tipperary Oil and Gas Corporation	
3. Address of Operator 800 N. Marienfeld, Suite 100, Midland, Tx 79701	
4. Well Location Unit Letter <u>E</u> : <u>1980</u> Feet From The <u>North</u> Line and <u>660</u> Feet From The <u>West</u> Line Section <u>21</u> Township <u>11S</u> Range <u>33E</u> NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4275.8 KB	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

3/21/95 Tagged up with tubing at 6245'. Pump 200 sx cmt at 6245'. WOC.

3/22/95 Load hole with water. Mix mud and displace with mud. Pump 25 sx at 6245'. WOC 4 hours. Tag plug at 5900'.

3/23/95 Cut 4½" csg at 3850' (100' below 8 5/8" shoe). Pull out of hole with csg. Pump 35 sk plug from 3900'-3700'. WOC. Tag plug at 3685'.

3/24/95 Cut 8 5/8" casing at 650'. POOH with casing. Set 45 sk plug at 700'-600'. WOC.

3/27/95 Tag plug at 585'. Pumped 65 sk plug at 435'-335'. WOC 4 hours. Tag at 333'. Pump 10 sk plug 30' - surface. Weld on dry hole marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE W. Jeffrey Sparks TITLE Engineer DATE 3/31/95
TYPE OR PRINT NAME W. Jeffrey Sparks TELEPHONE NO. (915)683-5203

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE JUN 1 1995
CONDITIONS OF APPROVAL, IF ANY: