

NEW MEXICO OIL CONSERVATION COMMISSION

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.	
E-7324	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. <input checked="" type="checkbox"/> OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER	7. Unit Agreement Name
2. Name of Operator Clar-Don Products Company	8. Farm or Lease Name State
3. Address of Operator c/o Oil Reports & Gas Services, Inc., Box 763, Hobbs, N. M. 88240	9. Well No. 3
4. Location of Well UNIT LETTER P 660 FEET FROM THE South LINE AND 660 FEET FROM THE East LINE, SECTION 14 TOWNSHIP 10 S RANGE 33 E NMPM.	10. Field and Pool, or Wildcat Inba Permo Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4210 KB	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Set Cast Iron Bridge Plug at 9675 with 35' cement on top.
Shot 5½ casing @ 4056 and pulled
Spot 100' plug across casing stub @ 4056 (40 sks - 3915-4055)
also covers 8 5/8" casing shoe @ 4007'.
Shot 8 5/8 casing @ 1256 and pulled
Spot 100' plug across 8 5/8" casing stub (60 sks - 1150-1250)
Spot 100' plug across 13 3/8 shoe @ 410 (75 sks 360-460)
10 sacks at surface. Install dry hole marker.
Mud between all plugs.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED W. J. Miller TITLE Agent DATE 1/31/74
APPROVED BY John W. Rungman TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: