

NEW MEXICO OIL CONSERVATION COMMISSION

DATE OF REPORT
REPORT NO.
WELL NO.

NAME OF OPERATOR
ADDRESS OF OPERATOR

DATE OF WELL CLOSURE
REASON FOR CLOSURE

NAME OF WELL
WELL NO.

DATE OF WELL CLOSURE
REASON FOR CLOSURE

NAME OF WELL
WELL NO.

DATE OF WELL CLOSURE
REASON FOR CLOSURE

NAME OF WELL
WELL NO.

DATE OF WELL CLOSURE
REASON FOR CLOSURE

DATE OF WELL CLOSURE
REASON FOR CLOSURE

DATE OF WELL CLOSURE
REASON FOR CLOSURE

DATE OF WELL CLOSURE
REASON FOR CLOSURE

DATE OF WELL CLOSURE
REASON FOR CLOSURE

CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, PLUG OR OTHER DATA
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK
TEMPORARILY ABANDON
FULL OR ALTER CASING
OTHER
PLUG AND ABANDON
CHANGE PLANS
REMEDIAL WORK
COMMENCE DRILLING OPER.
CASING TEST AND CEMENT JOBS
OTHER
ALTERING CASING
PLUG AND ABANDONMENT

10. Distance in feet or Completed Operations (indicate all pertinent details, and give pertinent dates, including estimated date of starting any proposed work, SEE RULES 100.

Plugged well in the following manner:

1. Run 2" tubing to 9663'.
2. Filled hole with mud.
3. Set 25 sk. plug 9663' to 9600'.
4. Cut and remove 5 1/2" casing @ 8461'.
5. Run 2" tubing to 8461'.
Set 25 sk plug 8461' to 8663'.
Set 25 sk plug 8663' to 8770'.
Set 25 sk plug 8770' to 8800'.
Set 25 sk plug 8800' to 8869'.
Pull remainder of tubing.
6. Cut and remove 3-5/8" casing @ 696'.
7. Set 40 sk plug 440' to 330'.
8. Set 10 sk surface plug 10' to 0'.
9. Test to regular flow marker.
10. With testing well location is ready for inspection. Pipe is too wet at present time to make clean up.

11. I hereby certify that the information herein is true and complete to the best of my knowledge and belief.

DATE OF REPORT
REPORT NO.
WELL NO.

SIGNATURE OF OPERATOR
DATE OF REPORT
REPORT NO.
WELL NO.