

Submit 3 Copies  
to Appropriate  
District Office

State of New Mexico  
Energy, Minerals and Natural Resources Department

Form C-103  
Revised 1-1-89

DISTRICT I  
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II  
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III  
1000 Rio Brazos Rd., Aztec, NM 87410

**OIL CONSERVATION DIVISION**  
P.O. Box 2088  
Santa Fe, New Mexico 87504-2088

WELL API NO.

5. Indicate Type of Lease  
STATE ☒ FEE ☐

6. State Oil & Gas Lease No.

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A  
DIFFERENT RESERVOIR. USE 'APPLICATION FOR PERMIT'  
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator

Dwight A. Tipton

3. Address of Operator

Box 1597, Lovington, NM 88260

4. Well Location

Unit Letter M : 520 Feet From The South Line and 660 Feet From The West Line

Section 3 Township 11S Range 33E NMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

**NOTICE OF INTENTION TO:**

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

**SUBSEQUENT REPORT OF:**

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Rig up wireline and set 5½ CIBP @ 8250'. Spot 10 sks. of cement on top.
2. Load hole with mud.
3. Spot 25 sks. of cement @ 7500'.
4. Cut 5½" casing @ 3189' and pulled.
5. Spot 25 sks. of cement @ 5100'.
6. Spot 25 sks. of cement @ 4500'.
7. Spot 25 sks. of cement @ 3785'.
8. Spot 50 sks. of cement @ 5½" stub @ 3239', 50' in & 50' out & tagged @ 3020'.
9. Cut 8 5/8" casing @ 355' and pulled.
10. Spot 30 sks. of cement @ 1800'.
11. Spot 30 sks. of cement @ 1040'.
12. Spot 30 sks. of cement @ 725'.
13. Spot 100 sks. of cement @ 400' @ 8 5/8" shoe & tag @ 283'.
14. Spot 50 sks. of cement @ 60' to surface.
15. Set up P & A marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Raymond Maldonado TITLE P & A Supervisor DATE 3-20-89

TYPE OR PRINT NAME Raymond Maldonado, P & A Supervisor, Baber Well Servicing Co. TELEPHONE NO. 505-397-3502

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE MAR 31 1989

CONDITIONS OF APPROVAL, IF ANY: