DISTRIBUTION SANTA FE FILE			-		
SANTA FE					Form C-103
					Supersedes Old C+102 and C+103
		NEW MEX	CICO OIL CONSERVA	ATION COMMISSION	Effective 1-1-65
U.S.G.S.					
LAND OFFICE					Sa. Indicate Type of Leave
OPERATOR					State X Foo [
COLUMN ON					5. State Oil 6 Gos Lease No.
diddir diasem selver y ir semenyaaningada kan has selve hare alaas a ir days yaanga se	C1 (5 175	OVERDER			Aller Charles Contraction Cont
too not use =	SUND THIS FORM TOR TO	RY NOTICES AND I	REPORTS ON WELL	LS A DIFFERENT RESERVOIR.	
manufationard or announce of the state of the desired desired and the state of the	OHE APPLICA	CHON FOR PERMIT IN (FOR	M C-101) FOR SUCH PROF	POSALS.)	7. Unit Agreement Name
OIL X	GAS WELL	OTHER-	*		r, coar agreement waite
, Name of Operator		\$ 1 ms/r."		and the second section of the section of	6. Furn or Lease Name
Skelly 0il Company					Vada Pruitt
3. Address of Operator					S. Well No.
P. O. Box 1351, Midland, Texas 79701					1
. Location of Well					10. Field and Pool, or Wildoot
UNIT LETTER M		660	South	660	Vada Penneylvenien
CALL DOLLER		FEET FROM T	HE	NE AND FEET	FROM THE
THE West	LINE. SECT	15	98	34E	
	LINE, SECT	TOW	AN2HIb	HANSE N	New Williams
THINNIN.	MANI	15. Elevatio	on (Show whether DF, R	T, GR, etc.)	12. County
		Willill.	4255' DF		Lea
	Check	Appropriate Box T	o Indicate Natura	of Notice, Report or	Other Date
t ₂		NTENTION TO:	' I	-	Uther Data ENT REPORT OF:
				20112EQU	ENT REPORT OF:
CREORM REMEDIAL WO	RK []	PLUG A	ND ABANDON REME	EDIAL WORK	ALTERING CASING
IMPORABILY ABANDON		, . <u></u>		MENCE DRILLING OPHS.	<u>}</u>
JLL OR ALTER CASING	Ħ	CHANGE	<u> </u>		PLUG AND ALANDONMENT
				NG TEST AND CENTERT IOD 1 1	
				NG TEST AND CEMENT JOB	L
OTHER				NG TEST AND CEMENT JOB	
work) see ROLE	1103.		all pertinent details, ar	THER	uling estimated date of starting any propose
1) Moved in 2) Set Cast loading it 3) Set Halli 4) Shot off and pulle 5) Set 80 se 6) Set 30 se 7) Shot off 8) Set 55 se 9) Set 75 se 10) Set 150 se 11) Set 30 se 12) Installed Well plugged	workover Iron Brid hole with iburton ce 4-1/2" OD ad 141 joi ack cement ack cement 8-5/8" OD ack cement	rig November 25 ige Plug 9720' v 10# mud. ment plug at 96 casing at 4996 ints (4430') 4-1 cplug 4350-5056 cplug 3950-4056 casing at 1176 cplug 2150-2356 cplug 1128-1228 at plug 350-450' cplug surface-6 cmarker.	all pertinent details, ar 5, 1976. Pulle with 35' cement 550' with 35' c 6' and could no 1/2" OD casing 0'. 3' and pulled 3'. 50'.	and give pertinent dates, included rods and tubing ton top. CIBP sincement on top, 96 to pull. Shot of the control of the cont	Inpped to 9800' while L5' PBTD. E 4-1/2" OD casing at 4401 8-5/8" OD casing.
1) Moved in 2) Set Cast loading it 3) Set Halli 4) Shot off and pulle 5) Set 80 se 6) Set 30 se 7) Shot off 8) Set 55 se 9) Set 75 se 10) Set 150 se 11) Set 30 se 12) Installed Well plugged mud. The 13' and the section	workover Iron Brid hole with iburton ce 4-1/2" OB ed 141 join ack cement ick	rig November 25 ige Plug 9720' v 10# mud. ment plug at 96 casing at 4996 ints (4430') 4-1 c plug 4350-5056 c plug 3950-4050 casing at 1178 c plug 2150-2350 c plug 1128-1228 at plug 350-450' c plug surface-6 a marker. loned December 7 ig was left surial/2" OD casing a	all pertinent details, or 5, 1976. Pulle with 35' cement 550' with 35' c 6' and could no 1/2" OD casing 1'. 3' and pulled 3' 50'. 7, 1975. All Face—382'. The set 4401—9835'	and give pertinent dates, included rods and tubing ton top. CIBP sincement on top, 962 of pull. Shot of the control of the con	Lipped to 9800' while L5' PBTD. E 4-1/2" OD casing at 4401 8-5/8" OD casing.
1) Moved in 2) Set Cast loading it 3) Set Halli 4) Shot off and pulle 5) Set 80 se 6) Set 30 se 7) Shot off 8) Set 55 se 9) Set 75 se 10) Set 150 se 11) Set 30 se 12) Installed Well plugged mud. The 13' and the section	workover Iron Brid hole with iburton ce 4-1/2" Of hol 141 joi hol 141 joi hol cement hok cement	rig November 25 ige Plug 9720' v 10# mud. ment plug at 96 casing at 4996 ints (4430') 4-1 c plug 4350-5056 c plug 3950-4050 casing at 1178 c plug 2150-2350 c plug 1128-1228 at plug 350-450' c plug surface-6 a marker. loned December 7 ig was left surial/2" OD casing a	all pertinent details, or 5, 1976. Pulle 7, 1976. Pulle 650' with 35' cement 65' and could no 1/2" OD casing 1/3' 60'. 7, 1975. All 6ace—382'. The set 4401—9835' lete to the best of my knowledge.	and give pertinent dates, included rods and tubing ton top. CIBP sizement on top, 96 to pull. Shot of the pull. Shot of the pull of the pu	Lipped to 9800' while L5' PBTD. F 4-1/2" OD casing at 4401 8-5/8" OD casing. anted were filled with 10# B" OD casing set 1178-4000 hole.
1) Moved in 2) Set Cast loading it 3) Set Halli 4) Shot off and pulle 5) Set 80 se 6) Set 30 se 7) Shot off 8) Set 55 se 9) Set 75 se 10) Set 150 se 11) Set 30 se 12) Installed Well plugged mud. The 13' and the section	workover Iron Brid hole with iburton ce 4-1/2" OB ed 141 join ack cement ick	rig November 25 lge Plug 9720' v 10# mud. ment plug at 96 lots (4430') 4-1 lots (4430') 4-1 lots plug 4350-5056 lots plug 3950-4050 lots plug 2150-2350 lots plug 1128-1228 lot plug 350-450' lots plug surface-6 lots marker. loned December 7 lig was left surface-1 lots plug surface-6 lot	all pertinent details, or 5, 1976. Pulle 7, 1976. Pulle 650' with 35' cement 65' and could no 1/2" OD casing 1/3' 60'. 7, 1975. All 6ace—382'. The set 4401—9835' lete to the best of my knowledge.	and give pertinent dates, included rods and tubing ton top. CIBP sincement on top, 965 of pull. Shot of the pull. Shot of the pull of the	Inpped to 9800' while L5' PBTD. F 4-1/2" OD casing at 4401 8-5/8" OD casing. Ented were filled with 10# B" OD casing set 1178-4000 hole.
1) Moved in 2) Set Cast loading it 3) Set Halli 4) Shot off and pulle 5) Set 80 se 6) Set 30 se 7) Shot off 8) Set 55 se 9) Set 75 se 10) Set 150 se 11) Set 30 se 12) Installed Well plugged mud. The 13' and the section	workover Iron Brid hole with iburton ce 4-1/2" OB ed 141 join ack cement ack cement ack cement ack cement ack cement ack cement ick	rig November 25 ige Plug 9720' v 10# mud. ment plug at 96 casing at 4996 ints (4430') 4-1 c plug 4350-5056 c plug 3950-4050 casing at 1176 c plug 2150-2350 c plug 1128-1226 at plug 350-450' c plug surface-6 a marker. loned December 7 ag was left surface-6 a marker. D. R. Crow	all pertinent details, or 5, 1976. Pulle with 35' cement 550' with 35' c 5' and could no 1/2" OD casing 1'. 3' and pulled 3' 50'. 7, 1975. All Face-382'. The set 4401-9835' lete to the best of my known in the could Title Leace	and give pertinent dates, included rods and tubing ton top. CIBP sizement on top, 96 to pull. Shot of the pull. Shot of the pull of the pu	Elipped to 9800' while L5' PBTD. F 4-1/2" OD casing at 4401 8-5/8" OD casing. Ented were filled with 10# B" OD casing set 1178-4000 hole.
1) Moved in 2) Set Cast loading it 3) Set Halli 4) Shot off and pulle 5) Set 80 se 6) Set 30 se 7) Shot off 8) Set 55 se 9) Set 75 se 10) Set 150 se 11) Set 30 se 12) Installed Well plugged mud. The 13' and the section	workover Iron Brid hole with iburton ce 4-1/2" OB ed 141 join ack cement ack cement ack cement ack cement ack cement ack cement ick	rig November 25 lge Plug 9720' v 10# mud. ment plug at 96 lots (4430') 4-1 lots (4430') 4-1 lots plug 4350-5056 lots plug 3950-4050 lots plug 2150-2350 lots plug 1128-1228 lot plug 350-450' lots plug surface-6 lots marker. loned December 7 lig was left surface-1 lots plug surface-6 lot	all pertinent details, or 5, 1976. Pulle with 35' cement 550' with 35' c 5' and could no 1/2" OD casing 1'. 3' and pulled 3' 50'. 7, 1975. All Face-382'. The set 4401-9835' lete to the best of my known in the could Title Leace	and give pertinent dates, included rods and tubing ton top. CIBP sizement on top, 96 to pull. Shot of the pull. Shot of the pull of the pu	Elipped to 9800' while L5' PBTD. F 4-1/2" OD casing at 4401 8-5/8" OD casing. anted were filled with 10# B" OD casing set 1178-4000 hole.