

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input checked="" type="checkbox"/>	Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. K-10334	
7. Unit Agreement Name	
8. Farm or Lease Name State M	
9. Well No. 1	
10. Field and Pool, or Wildcat Vada Penn	
12. County Lea	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT - 1" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
2. Name of Operator Joseph I. O'Neill Jr.	
3. Address of Operator 410 West Ohio Ave., Midland, Texas 79701	
4. Location of Well UNIT LETTER A 660 FEET FROM THE North LINE AND 660 FEET FROM THE East LINE, SECTION 19 TOWNSHIP 10S RANGE 34E NMPM.	
15. Elevation (Show whether DF, RT, GR, etc.)	

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set C.I.B.P. @ 9700' with 35 sks of cement plug.
2. Displace hole with mud laden fluid.
3. Set 50 sks. cement plug @ 8006'
4. Shoot 5-1/2" csg. @ 7478' and pull 5-1/2" cgs. and set 100 sks. cement plug in and out of stub.
5. Set 50 sks. cement plug over Gloretta zone @ 5400'
6. Set 50 sks. cement plug in and out of 8-5/8" shoe @ 3975'
7. Shoot 8-5/8" csg. @ 988' and pull 8-5/8" pipe and set 65 sks. cement plug in and out of stub @ 988'.
8. Set 75 sks. cement plug in and out of shoe of 13-3/8" surface @ 420'
9. Set dry hole marker and 10 sks. cement plug @ surface.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED John W. Wilson TITLE Agent DATE 10/1/74

APPROVED BY William E. Clegg TITLE Director DATE

CONDITIONS OF APPROVAL, IF ANY: