

Form 100-5
(June 1991)

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

5. Lease Designation and Serial No.

NM 0336039

6. If Indian, Allottee or Tribe Name

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

SUBMIT IN TRIPLICATE

7. If Unit or CA, Agreement Designation

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

Petroleum Production Management, Inc.

3. Address and Telephone No.

P.O. Box 957 Crossroads, New Mexico 88114 675-2478

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

UL-F, 1980' FNL and 1980' FWL, Sec. 31, T-9-S, R-34-E

8. Well Name and No.

Midwest G Fed Com # 1

9. API Well No.

30-025-22715

10. Field and Pool, or Exploratory Area

Vada Penn

11. County or Parish, State

Lea, N.M.

CHECK APPROPRIATE BOX(S) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☒ Notice of Intent

☐ Subsequent Report

☐ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Move in and rig up plugging unit.
2. Pull and lay down rods.
3. Pull tubing.
4. Set CIBP at 9700', spot 50' of cement on top of CIBP.
5. Load hole with salt gel mud.
6. Cut and pull 5 1/2" casing and spot 100' cement plug 50' inside and 50' (50' in 7,000') outside 5 1/2" casing stub. Tag plug.
7. Spot 100' cement plug at base of 8 5/8" casing at 4019'. (50' in 4000') tag plug
8. Cut and pull 8 5/8" casing. Spot 100' cement plug 50' inside and 50' (50' in 4000') outside 8 5/8" casing stub. Tag plug.
9. Spot 100' cement plug at base of 11 3/4" casing at 385'. Tag plug. (50' in 4000')
10. Spot 50' cement plug at surface. Install dry hole marker and clean location.

14. I hereby certify that the foregoing is true and correct

Signed Harry H. Baird

Title District Superintendent

Date 6-7-94

(This space for Federal or State office use)

Approved by (ORIG. SGD.) JOE G. LARA
Conditions of approval, if any

Title PETROLEUM ENGINEER

Date 7/6/94

Changes above & w/ attachment.

Title 18 U.S.C. Section 1001 makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

BUREAU OF LAND MANAGEMENT
CARLSBAD RESOURCE AREA

Permanent Abandonment of Wells on Federal Lands

Conditions of Approval

1. Approval: Plugging operations shall commence within 90 days from the approval date of plugging procedure.
2. Notification: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Eddy County call (505)887-6544 ; for wells in Lea County call (505) 393-3612.
3. Blowout Preventers: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet ; and a 5M system for a well not deeper than 22,727 feet.
4. Mud Requirement: Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of water. Minimum nine (9) pounds per gallon.
5. Cement Requirement: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either class "C" , for up to 7,500 feet of depth, mixed at 14.8 lbs./gal. with 6.3 gallons of fresh water per sack or class "H" , for deeper than 7,500 feet plugs, mixed at 16.4 lbs./gal. with 4.3 gallons of fresh water per sack.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement. The following information shall be permanently inscribed on the dry hole marker: Well name and number, the name of the operator, the lease serial number, the surveyed location (the quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer; such as metes and bounds).
7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and five copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. Show date well was plugged.

Following the submittal and approval of the Subsequent Report of Abandonment, surface restoration conditions of approval will be developed and furnished to you.