

WARD INSALL COM. NO. 2
Daily Report Summary From PBCP Services, Inc.

- 9-17-79 RU laydown 50 jts. 1" kobe tbg. SDON
- 9-18-79 Laydown 157 jts. 1". 26 jts. plugged.
Remove 2-7/8" flange. Could not get tbg. loose.
- 9-19-79 RU McCullough and shot off 2-7/8" @ 6781½'. Circ.
hole w/mud laden 10# brine. SDON.
- 9-20-79 Pump 40 sx plug @ 6781'. Laydown 33 jts. 2-7/8"
stand back 93. RU and run wireline. Tag cmt. @ 6378'.
- 9-21-79 Remove 5½" flange. Weld on 5½" pull nipple. RU
and shoot 5½" @ 5012'. Work pipe and came free.
Laydown 23 jts. SDON.
- 9-24-79 Laydown 137 jts. 5½". Run tubing to 5012'. Could
not get into casing. SDON.
- 9-25-79 Call Commission. OK to set plug at 5012'. Spot
50 sxs. Laydown 31 jts. WOC. RU wireline tag plug
at 3365' in tubing. POOH. 22 jts of tubing plugged.
Run tubing to 4100'. Run wireline tag plug @ 4901'.
SDON.
- 9-26-79 Load hole w/10# mud laden brine. Pump 50 sxs @
4100'. Laydown 64 jts. WOC RU wireline. Tag plug
@ 3973'. Spot 35 sxs @ 2100'. Stand back tubing.
Remove 8-5/8" wellhead. Weld on a pull nipple.
- 9-27-79 Rig jacks. Remove 8-5/8" slips. Work pipe and shoot
@ 985'. Laydown 31 jts. 8-5/8". Run tubing to 1035'
spot 50 sxs. Pull tubing. SDON.
- 9-28-79 Run wireline. Tag plug @ 937'. Run tubing to 426'.
Spot 75 sxs plug @ 426'. Laydown tubing WOC 3 hrs.
RU wireline. Tag plug @ 308'. RD. Cut 13-3/8" head
off. Spot 10 sxs @ surface. Weld cap on 13-7/8" and
dry hole marker.

RECEIVED

AUG 16 1983

**O.C.D.
HOBBS OFFICE.**