

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
2. Name of Operator Sun Oil Company	5. State Oil & Gas Lease No. L-196 & K-2519
3. Address of Operator P. O. Box 1861 Midland, Texas 79701	7. Unit Agreement Name
4. Location of Well UNIT LETTER <u>K</u> , <u>760</u> FEET FROM THE <u>North</u> LINE AND <u>1981</u> FEET FROM THE <u>West</u> LINE, SECTION <u>4</u> TOWNSHIP <u>11 S</u> RANGE <u>34 E</u> NMPM.	8. Farm or Lease Name N. M. "N" St. Oil Com.
	9. Well No. 2
	10. Field and Pool, or Wildcat Inbe Permo Penn.
15. Elevation (Show whether DF, RT, GR, etc.) 4218- Gr.	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐
TEMPORARILY ABANDON ☐
PULL OR ALTER CASING ☐
OTHER ☐

PLUG AND ABANDON ☐
CHANGE PLANS ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐
COMMENCE DRILLING OPNS. ☐
CASING TEST AND CEMENT JOBS ☐
OTHER ☐

ALTERING CASING ☐
PLUG AND ABANDONMENT ☒

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Casing pullers - C. E. Knight & Co., Box 86, Snyder, Texas.

6-10-71 Move in and spot 25 sk plug 9860-9960.
6-11-71 Check top of plug @ 9965. Load hole with 9.5# mud. Prepare to shoot 5 1/2" casing.
6-16-71 Shoot and pull 5 1/2" casing from 4500.
6-17-71 Casing parted at 2800 ft. Pulled and laid down this amount.
6-18-71 Could not run tubing below 2900 ft. Spot 45 sk plug 2762-2900. Shoot and pull 8 5/8" casing from 1230.
6-21-71 Spot plugs: 25 sks 9675-9775, 45 sks 2620-2720, 55 sks 1150-1250, 55 sks 350-450, 10 sks @ surface. Set marker and clear location.

Pipe left in hole: 400' of 13 3/8, 2810' of 8 5/8, 7216' of 5 1/2.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED

W. H. Hughes

TITLE

Proration Clerk

DATE

6-30-71

APPROVED

Nathan E. Clegg

TITLE

FOR

DATE

CONDITIONS OF APPROVAL, IF ANY: