

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS <small>(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)</small>		
1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name
2. Name of Operator BTA OIL PRODUCERS		8. Farm or Lease Name Intex 692 Ltd.
3. Address of Operator 104 South Pecos Midland, Texas 79701		9. Well No. 1
4. Location of Well UNIT LETTER L , 1980 FEET FROM THE South LINE AND 660 FEET FROM THE West LINE, SECTION 8 TOWNSHIP 9-S RANGE 35-E NMPM.		10. Field and Pool, or Wildcat Vada-Penn
15. Elevation (Show whether DF, RT, GR, etc.) 4203' K. B.		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:	
REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Call NMOCC Hobbs 24 hours in advance
Hole to be filed w/mud laden fluid
Unseat anchor & lay down 2-7/8" tbg.
Set CIBP @ 9700' w/3 sx cmt on top
Cut & pull 5-1/2" csg. - top cmt @ 8150'
Set 50 sx @ 5-1/2" stub
Set 50 sx @ 5425' (Glorietta)
Set 50 sx @ 4011'
Cut & pull 8-5/8" csg.
Set 50 sx @ 8-5/8" stub
Set 50 sx @ 385'
Set 10 sx @ surface
Install dry hole marker

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED [Signature] TITLE Production Secretary DATE 8/2/72
APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE AUG 7 1972
CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

AUG 7 1972

OIL CONSERVATION COMM.
HOUSTON, TEXAS