Form C-103

TMENT	
	OIL CONS
	Р.
	SANTA FE
	TMENT

## SERVATION DIVISION

rorm U-	כטו
Revised	10-1-78

DISTRIBUTION	DA B			Kevised 10-1-70	
DISTRIBUTION	P.O. Box	•	1 = 1		
SANTA FE	SANTA FE, NEW N	MEXICO 87501	5a. Indicate T	· 1	
FILE	†		State X	Fee	
U.S.G.S LAND OFFICE	+	-	E C4-4-011 8		
OPERATOR OPERATOR	1		D. State OII &	Gas Lease No.	
OF ERATOR	Į.			_	
SIMORY	NOTICES AND REPORTS ON WELLS		XXXXXXXXXXXXX	XXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX	
		N OR PLUG BACK TO A DIFFERENT		xxxxxxxxxxxxxxxx	
	PLICATION FOR PERMIT-" (FORM (		f	KXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXXX	
OIL GAS	ETONTION TON PENETT CHOICE	5 TOTA TON SOOT THO OSKES,7	7. Unit Agreem		
WELL X WELL	. OTHER		j		
. Name of Operator			8. Farm or Lea	se Name	
Read & Stevens, Inc.			State	t	
Address of Operator			9. Well No.		
P.O. Box 1518, Roswell, NM	4 88201			1	
. Location of Well			10. Field and	Pool, or Wildcat	
UNIT LETTER A . 66	60 FEET FROM THE North	LINE AND 510 FEET FROM	Inbe Permo	Penn	
THE_EastLINE. SECTIO	ON 28 TOWNSHIP 10S	RANGE 33E NMPM		<b>\```\``\``\`\`\`\`\`\`\\\\\\\\\\\\\\\</b>	
:xxxxxxxxxxxxxxxxxxxxxxxxxxxxxx	(XX 5. Elevation(Show whether	r DF,RT,GR,etc.)	12. County	XXXXXXXXXXXXXXXX	
xxxxxxxxxxxxxxxxxxxxxxxxxxx	(XX 4196.61 GL		Lea	XXXXXXXXXXXXXXXXX	
	1	ature of Notice, Report or Oth			
NOTICE OF INT	ENTION TO:	SUBSEQUENT RE	PORT OF:		
DEDECOM BENEDIAL MODE	PLUG AND ABANDON	DEMENTAL MORE	T ALTERIAL	G CASING 1 1	
PERFORM REMEDIAL WORK TEMPORARILY ABANDON	CHANGE PLANS	REMEDIAL WORK  COMMENCE DRILLING OPNS.	<del></del>	D ABANDONMENT X	
PULL OR ALTER CASING	- CHANGE LEAGS	CASING TEST AND CEMENT JOB	T LUG AN	D VOVUDOUMENT 1 - V-1	
OTHER	<del></del>	OTHER	<del>                                     </del>	1777	
				<del></del>	
escribe Proposed or Complete	od Operations(Clearly state a	Il pertinent details, and give	pertinent date	s. including esti-	
nated date of starting any pr			•	, ,	
11-2-82 Set CIBP @ 95501	w/301 cmt on top of plug. C	irculate hole with mud.			
11-3-82 Spot 224' plug,	25sx, 8742'-8518'.				
11-4-82 Cut casing off a	$\pm \frac{+}{6000}$ . Pull casing, TOC	@ 7800'.			
11-7-82 Spot 206' plug, 40sx, half in and half out of casing stub, 6000'-5794', tag @ 5817',					
Spot 180' plug, 35sx, 5282'-5102'. Spot 206' plug, 40sx, half in and half out of 8 5/8"					
	375', 3969'-3763', tag cmt @ 3		- ,		
ū	•				
11-10-82 Cut 8 5/8" cas1m	ig off @ <u>+</u> 1000'. Spot 177' p	lug, 50sx, 861'-1038', half in	and half out		
of 8 5/8" casing	g stub. Tag cmt € 890'.				
11-11-82 Spot 124' plug,	65sx, 4091-2851, across 13 3,	/8" casing shoe @ 370".	•		
11-12-82 Spot surface plu	ig, 10sx, w/dry hole marker, o	4"X10', with well description.			
Note: Will clean up loc	cation and notify OCD when rea	ady for inspection.			
I hereby certify that the information above is true and complete to the best of my knowledge and belief.					
SIGNED B	TITLE	Drilling & Production Manage	or DATE 1	1-18-82	
	1011-1				
APPROVED BY Davies	& Calanoch TITLE	OIL & GAS INSPECT	COR DATE AL	<del>JG 1                                   </del>	

CONDITIONS OF APPROVAL, IF ANY:

RECEIVED

NOV 19 1982

O.C.B. Hobbs office