

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>		7. Unit Agreement Name	
2. Name of Operator BTA Oil Producers		8. Farm or Lease Name Hugo 693 Ltd.	
3. Address of Operator 104 S. Pecos, Midland, Texas 79701		9. Well No. /	
4. Location of Well UNIT LETTER <u>D</u> <u>660</u> FEET FROM THE <u>North</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>15</u> TOWNSHIP <u>9-S</u> RANGE <u>35-E</u> NMPM.		10. Field and Pool, or Wildcat Vada - Penn	
15. Elevation (Show whether DF, RT, GR, etc.) 4163' G.R.		12. County Lea	

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugging Procedure

- Moved in Permian Basin Casing Pullers.
- Set CIBP @ 9750' w/3 sx cmt on top.
- Shot 5-1/2" csg @ 8146', 7880'; rec 5796' of 5-1/2" csg.
Set 50 sx cmt @ 5795'; 50 sx @ 5502'; 50 sx @ 4067'.
- Shot 8-5/8" csg @ 1324' & 1240'; rec 1240' of 8-5/8" csg.
Set 50 sx cmt @ 1240'; 50 sx @ 375'; 10 sx @ surface.
- Install dry hole marker.

P & A 11-23-73

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>John Ruryan</u>	TITLE <u>Production Clerk</u>	DATE <u>12-5-73</u>
APPROVED BY <u>John Ruryan</u> Geologist	TITLE <u>Geologist</u>	DATE <u>12-5-73</u>
CONDITIONS OF APPROVAL, IF ANY:		