

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease
State ☐ Fee ☒

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Imperial-American Management Company	8. Farm or Lease Name Marg McGuffin
3. Address of Operator 215 Mid America Bldg., Midland, Texas 79701	9. Well No. 1
4. Location of Well UNIT LETTER M , 660 FEET FROM THE S LINE AND 660 FEET FROM THE W LINE, SECTION 24 TOWNSHIP 9-S RANGE 32-E NMPM.	10. Field and Pool, or Wildcat South Flying M Penn
15. Elevation (Show whether DF, RT, GR, etc.)	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOBS <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set wire line bridge plug at 8897'. Pumped 25' cmt. on plug.'
2. Shot 5½" casing off at 2850'. Pulled casing.
3. Ran tubing to 4984'. Ran two cement plugs totalling 200 sacks. Pulled tbg. WOC 48 Hrs.
4. Ran tubing and tagged plug. Set a 50 sack plug at 2900'.
5. Shot 8-5/8" casing at 907'. Pulled 8-5/8".
6. Ran tubing to 957'. Set 65 sack plug.
7. Pulled tubing to 415'. Set a 70 sack plug. Pulled tubing
8. Set a 10 sack plug at surface.
9. Cleaned location. Work completed 4-30-74.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED L. P. Suenkel TITLE Agent

DATE June 10, 1974

APPROVED BY William E. Clegg
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____ DATE _____