DISTRIBUTION TA FE E G.S. HD OFFICE	Form C-103 Supersedes Old C-102 and C-103 Effective 1-1-65 Sa. Indicate Type of Lease State Fee X 5. State Oil 5 Gas Lease No.
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. (DO NOT USE THIS FORM FOR PROPOSALS.)	7. Unit Agreement Name
OIL Y GAS OTHER-	8. Form or Lease Name Stone 9. Well No.
xas Pacific Oil Company, Inc. ddress of Operator O. Box 4067, Midland, Texas 79701	10. Field and Pool, or Wildoot
OCCITION OF WELL UNIT LETTER L 1874 FEET FROM THE SCUTH LINE AND 554 FEET FROM THE WOST LINE, SECTION 26 TOWNSHIP 9-S HANGE 34-E NM	Yada Penn
15. Elevation (Show whether DF, RT, GR, etc.)	Lea
NOTICE OF INTENTION TO:	ENT REPORT OF:
PLUG AND ABANDON PEMEDIAL WORK COMMENCE DRILLING OPNS. CHANGE PLANS CHANGE PLANS OTHER OTHER	PLUG AND ABANDONMENT (X
7. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, incl	luding estimated date of starting any propose
Rig up pulling unit and pull rods and tubing. 1. Rig up pulling unit and pull rods and tubing. 2. Set CIBP @ 9800' and cap w/35' of cement. 3. GIH w/tubing and displace hole w/10# brine containing 25 sx. get. 4. Determine free point of 5 1/2" casing, at 4021'. Recovered 402. 5. GIH w/tubing and spot 70 sx. cement across top of 5 1/2" casing. 6. 8 5/8" casing, cut off and pull 990'. 7. GIH w/tubing and spot 70 sx. cement across top of 8 5/8" casing. 8. Cut off well head and cap well with 10 sx. of cement. Install. 9. Cut deadmen, remove well equipment, battery equipment and clear.	1/100 bbls. POH. 21' 5 1/2" casing 3, at 4035' 3 at 1023'. Spot 70 sx.

المناسطين الما

DATE