

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-23471-0001
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. LC-1796-1
7. Lease Name or Unit Agreement Name State AR
8. Well No. 3
9. Pool name or Wildcat Echols (Devonian)
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3956' KB

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	2. Name of Operator Lynx Petroleum Consultants, Inc.
3. Address of Operator P. O. Box 1979, Hobbs, NM 88241	4. Well Location Unit Letter L : 660 Feet From The North Line and 990 Feet From The West Line Section 2 Township 11S Range 37E NMPM Lea County
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3956' KB	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4/01/91 RU. Pull rods and tubing and lay down.
4/02/91 Pull rest of tubing. Go back in hole with bit and scraper.
4/03/91 Run bit to 11200'. Pull out of hole. Set CIBP at 11200'. Test tubing back in hole.
4/04/91 Circulate mud. Spot 15 sxs cement at 11200' on plug. Pull tubing to 7700'. Spot 25 sxs cement from 7700-7460'. Pull tubing to 4850'. Spot 25 sxs cement. Pull tubing to 3500'.
4/05/91 Tag plug at 4700'. Circulate mud. Pull tubing to 2200'. Spot 25 sxs cement from 2200-2075'. Pull tubing to 400'. Spot 25 sxs cement from 400-275'. Pull to 50' from surface. Circulate 10 sxs cement.
4/06/91 Cut off wellhead. Install marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Marc Wise TITLE President DATE 2/4/92

TYPE OF PRINT NAME Marc L. Wise TELEPHONE NO 392-6950

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE FEB 10 1992