

PURVIS OIL CORP.

One First City Center, Suite 960

Mailing Address
P.O. Box 11006
MIDLAND, TEXAS 79702
(915) 682-7346
Fax (915) 683-9584

STATE "15" #1

1980' FNL & 1980' FWL
Section 15, T-10-S, R-34-E, NMPM
Lea County, New Mexico

DIRECTIONS TO WELL:

8.6 Miles West of Crossroads, and South 4.6 miles to dead end, then East approximately 1000' to location.

PROPOSED PROCEDURE:

1. Dig out cellar to 13 3/8" surface casing. Drill cement plugs at top of surface casing.
2. Re-enter hole to stub of 8 5/8" casing at 547' and drill out cement plug.
3. Tie back to 8 5/8" casing with casing bowl.
4. Drill out cement plugs in hole at 5,450' (25 sx.), 7,750' (25 sx.), and 9,050' (25 sx.).
5. Run DST in Abo formation (approx. 9050').
6. Run 5 1/2" casing to 9,150' or P&A.
7. If production casing is run, acidize and complete and put on production.