

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	

## SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER-		7. Unit Agreement Name
2. Name of Operator Tenneco Oil Company		8. Farm or Lease Name Barton Santa Fe
3. Address of Operator Suite 1200 Lincoln Tower Bldg., Denver, Colorado 80203		9. Well No. 1
4. Location of Well UNIT LETTER <u>L</u> , <u>1980</u> FEET FROM THE <u>South</u> LINE AND <u>660</u> FEET FROM THE <u>West</u> LINE, SECTION <u>10</u> TOWNSHIP <u>9S</u> RANGE <u>36E</u> NMPM.		10. Field and Pool, or Wildcat Vada (Penn)
15. Elevation (Show whether DF, RT, GR, etc.) 4064' GR		12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☒  
CHANGE PLANS ☐  
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOBS ☐  
OTHER ☐  
ALTERING CASING ☐  
PLUG AND ABANDONMENT ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Final plugging of well as follows:

1. Pick up and go in hole with 4150' of 2-7/8" tubing or until tubing stops.
2. Spot 100' plug and pull tubing out of hole, stand back 28 stands and lay down remainder.
3. Shoot off 8-5/8" casing at  $\pm$  1700' or free point and POH laying down casing.
4. Run 28 stands tubing in hole w/bent joint on bottom.
5. Spot 100' plug half in and half out of 8-5/8" stub.
6. POH to 375' and spot 100' plug 375' to 325'. (13-3/8" set @ 356')
7. POH laying down all tubing.
8. Install dry hole marker and 10 sx surface plug.
9. Clean up location and notify NMOCC when ready for inspection.

Note: All plugs to have 9.5#/gal. mud in between them.

Estimated date of starting above proposed work: 2 days after approval.

THE COMMISSION MUST BE NOTIFIED 24 HOURS PRIOR TO THE BEGINNING OF PLUGGING OPERATIONS FOR THE C-103 TO BE APPROVED.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Saul J. Rogers</u>	TITLE <u>Sr. Production Clerk</u>	DATE <u>5/29/74</u>
APPROVED BY <u></u>	TITLE <u></u>	DATE <u></u>
CONDITIONS OF APPROVAL, IF ANY:		