

STATE OF NEW MEXICO  
ENERGY AND MINERALS DEPARTMENT

OIL CONSERVATION DIVISION  
P.O. Box 2088  
SANTA FE, NEW MEXICO 87501

Form C-103  
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
ANTA FE	
ILE	
.S.G.S	
AND OFFICE	
PERATOR	

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>

5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR, USE "APPLICATION FOR PERMIT-" (FORM C-1011 FOR SUCH PROPOSALS.)

OIL WELL ☐ GAS WELL ☐ OTHER Dry Hole

Name of Operator  
Read & Stevens, Inc.

Address of Operator  
P.O. Box 1518, Roswell, NM 88201

Location of Well

UNIT LETTER D 554 FEET FROM THE North LINE AND 554 FEET FROM  
THE West LINE. SECTION 19 TOWNSHIP 9S RANGE 34E NMPM

5. Elevation (Show whether DF, RT, GR, etc.)  
4308.5' GR

7. Unit Agreement Name

8. Farm or Lease Name  
Sheridan "Com"

9. Well No.

10. Field and Pool, or Wildcat

Vada Penn

12. County  
Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐  
TEMPORARILY ABANDON ☐  
PULL OR ALTER CASING ☐  
OTHER ☐

PLUG AND ABANDON ☐  
CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐  
COMMENCE DRILLING OPNS. ☐  
CASING TEST AND CEMENT JOB ☐  
OTHER ☐

ALTERING CASING ☐  
PLUG AND ABANDONMENT ☒

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

12-14-82 RUCU, pull rods.  
12-15-82 Pull rods, pump & tbgs. Set CIBP w/30' cmt @ 9600'  
12-16-82 Circ hole w/mud. 25sx @ 8900'-8700'.  
12-17-82 Pulled tbgs, prep to pull csg, dismantle tank battery.  
12-18-82 Determine free point, free @ 3400'.  
12-19-82 Cut csg @ 3400', pull & LD 100jts 5 1/2" csg.  
12-21-82 Ran tbgs to 5400', spot 35sx 5400'-5100' tagged, spot 35sx 4050'-3936' tagged, 42sx @ 3450'-3279'.  
12-22-82 Weld on to 8 5/8" csg cut @ 890', pull 180,000# work loose, start pulling csg.  
12-23-82 Pull 892' 8 5/8" csg, spot 42sx cmt, plug 1/2 in & 1/2 out of csg stub @ 892'.  
12-24-82 Spot 65sx 400'-200', spot 15sx @ surface w/dry hole marker.  
12-29-82 Move CU off location, clean up location. Ready for inspection.

NOTE: Sundry of 12-29-82 is being resubmitted 1-7-83 to add the plug on 12-16-82 which was left off in error.

hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED B. Stubbs

TITLE Drilling & Production Manager

DATE 1-7-83

APPROVED BY David Culanack

TITLE OIL & GAS INSPECTOR

DATE JUL 11 1983

CONDITIONS OF APPROVAL, IF ANY: