(May 1963)	DEPAR	UN TED STATE TME OF THE GEOLOGICAL SUI	INTERIO	SUBMIT IN TRIPT-A (Other Instruction ) verse side)	re- 5. lea NM	Form approved Budget Bureau se designation at [-2390-A INDIAN, ALLOTTEE	No. 42-R142 ND SERIAL NO
(Do not use thi	NDRY NC	DIICES AND REP posals to drill or to deeper CATION FOR PERMIT	ORTS ON n or plug back for such prope	WELLS to a different reservoir. ssals.)		T AGREEMENT NAM	
I. OIL GAS WELL WELL X OTHER					1. 641	1. UNIT AUREEMENT NAME	
WELL WELL OTHER   2. NAME OF OFFICATOR Content Content						8. FARM OR LEASE NAME	
Flag-Redfern Oil Company						Bilbrey 90 9. WELL NO.	
3. ADDRESS OF OPEBATOR P. O. Box 23, Midland, Texas 79701					1		
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.)						ELD AND POOL, OR	WILDCAT
At surface			<b></b>		11. SE	Undesignated 11. SEC., T., B., M., OR BLK. AND	
1980' FSL &	, 1980' FE	EL, Section 14,	1-9-5, K	-21-5		SURVEY OR AREA	•.
				·		UNTY OB PARISH	
14. PSRMIT NO.		15. ELEVATIONS (Show	v whether DF, RT 990' GR	, GR, etc.)	12. co		New Mex
		1			•	<u> </u>	Hew Hen
16.	Check /	Appropriate Box To I	ndicate Nat	ure of Notice, Report,			
	NOTICE OF INI	TENTION TO:		SU	BSEQUENT RE	PORT OF:	<b>—</b>
TEST WATER SHUT	-077	PULL OR ALTER CASING		WATER SHUT-OFF		REPAIRING WI	[]
FRACTURE TREAT		MULTIPLE COMPLETE		FRACTURE TREATMENT SHOOTING OR ACIDIZING		ALTERING CAS ABANDONMENT	
SHOOT OR ACIDIZE		ABANDON* CHANGE PLANS		(Other)	i		
(Other)				(Note: Report re Completion or Red letails, and give pertinent d	completion Re	eport and Log forn	n.)
			- <b>,</b> · <b>,</b>	, 27, 65, 66, 67	, 00, 0	, , , , , , , , , , , , , , , , , , , ,	
<u>Abandonment</u> 6-20-73	Set cast plug with	iron bridge plu bailed. Loade	g at 4850 d hole wi	)'. Dumped 38' c th mud laden flu	ement pi	lug on top	on
<u>Abandonment</u> 6-20-73 5 6-21-73 5	Set cast plug with Shot casi Shot casi spotted 3	iron bridge plu bailed. Loade ng at 3024 and ng at 1233 ft. 5 sack cement p	g at 4850 d hole wi unable to Worked o lug from	)'. Dumped 38' c th mud laden flu break circulati asing free. Bro 1233' back to ll	ement p id. on or mo ke circo 33'. Pa	lug on top ove pipe. ulation and ulled casim	l 1g
<u>Abandonment</u> 6-20-73	Set cast plug with Shot casi Shot casi spotted 3 to 471' a	iron bridge plu bailed. Loade ng at 3024 and ng at 1233 ft. 5 sack cement p nd spotted 35 s	g at 4850 d hole wi unable to Worked o lug from	)'. Dumped 38' c th mud laden flu break circulati asing free. Bro	ement p id. on or mo ke circo 33'. Pa	lug on top ove pipe. ulation and ulled casim	l 1g
<u>Abandonment</u> 6-20-73	Set cast plug with Shot casi Shot casi spotted 3 to 471' a casing ou	iron bridge plu bailed. Loaded ng at 3024 and o ng at 1233 ft. 5 sack cement p nd spotted 35 s t of hole.	g at 4850 d hole wi unable to Worked o lug from ack cemen	)'. Dumped 38' c th mud laden flu break circulati asing free. Bro 1233' back to ll	ement p id. on or ma ke circu 33'. Pa back to	lug on top ove pipe. ulation and ulled casim	l 1g
<u>Abandonment</u> 6-20-73 5 6-21-73 5 6-22-73 5	Set cast plug with Shot casi Shot casi spotted 3 to 471' a casing ou Spotted 1	iron bridge plu bailed. Loader ng at 3024 and ng at 1233 ft. 5 sack cement p nd spotted 35 s t of hole. 0 sx cement in	g at 4850 d hole wi unable to Worked o lug from ack cemen top of ca	). Dumped 38' c th mud laden flu break circulati asing free. Bro 1233' back to 11 nt plug from 471'	ement p id. on or mo ke circo 33'. P back to	lug on top ove pipe. ulation and ulled casim	l 1g
<u>Abandonment</u> 6-20-73 5 6-21-73 5 6-22-73 5	Set cast plug with Shot casi Shot casi spotted 3 to 471' a casing ou Spotted 1	iron bridge plu bailed. Loader ng at 3024 and ng at 1233 ft. 5 sack cement p nd spotted 35 s t of hole. 0 sx cement in	g at 4850 d hole wi unable to Worked o lug from ack cemen top of ca	)'. Dumped 38' c th mud laden flu break circulati asing free. Bro 1233' back to 11 nt plug from 471' asing with marker	ement p id. on or mo ke circo 33'. P back to	lug on top ove pipe. ulation and ulled casim	l 1g
<u>Abandonment</u> 6-20-73 5 6-21-73 5 6-22-73 5 Contractor	Set cast plug with Shot casi Shot casi spotted 3 to 471' a casing ou Spotted 1 - Cactus	iron bridge plu bailed. Loaded ng at 3024 and m ng at 1233 ft. 5 sack cement p nd spotted 35 s t of hole. 0 sx cement in Casing Pulling	g at 4850 d hole wi unable to Worked o lug from ack cemen top of ca	)'. Dumped 38' c th mud laden flu break circulati asing free. Bro 1233' back to 11 nt plug from 471' asing with marker	ement p id. on or mo ke circo 33'. P back to	lug on top ove pipe. ulation and ulled casim	l 1g
Abandonment 6-20-73 S 6-21-73 S 6-22-73 S Contractor 16. I hereby contry th SIGNED	Set cast plug with Shot casi Shot casi spotted 3 to 471' a casing ou Spotted 1 - Cactus	iron bridge plu, bailed. Loaded ng at 3024 and o ng at 1233 ft. 5 sack cement p nd spotted 35 s t of hole. 0 sx cement in Casing Pulling	g at 4850 d hole wi unable to Worked o lug from ack cemen top of ca	b'. Dumped 38' c th mud laden flu break circulati asing free. Bro 1233' back to 11 at plug from 471' asing with marker Hobbs, New Mexico	ement p id. on or mo ke circo 33'. P back to	lug on top ove pipe. ulation and ulled casin o 371'. Pu DATE 7-6-	l 19g 11ed
Abandonment 6-20-73 5 6-21-73 5 6-22-73 5 Contractor	Set cast plug with Shot casi Shot casi spotted 3 to 471' a casing ou Spotted 1 - Cactus	iron bridge plu, bailed. Loaded ng at 3024 and o ng at 1233 ft. 5 sack cement p nd spotted 35 s t of hole. 0 sx cement in Casing Pulling	g at 4850 d hole wi unable to Worked o lug from ack cemen top of ca	b'. Dumped 38' c th mud laden flu break circulati asing free. Bro 1233' back to 11 at plug from 471' asing with marker Hobbs, New Mexico	ement p id. on or mo ke circo 33'. P back to	lug on top ove pipe. ulation and ulled casin o 371'. Pu DATE 7-6-	l ng nlled
Abandonment 6-20-73 S 6-21-73 S 6-22-73 S Contractor 18. I hereby contry th SIGNED	Set cast plug with Shot casi Shot casi spotted 3 to 471' a casing ou Spotted 1 - Cactus	iron bridge plu bailed. Loaded ng at 3024 and o ng at 1233 ft. 5 sack cement p nd spotted 35 s t of hole. 0 sx cement in Casing Pulling	g at 4850 d hole wi unable to Worked o lug from ack cemen top of ca , Inc., F	)'. Dumped 38' c th mud laden flu break circulati asing free. Bro 1233' back to 11 at plug from 471' asing with marker Hobbs, New Mexico	ement pi id. on or mo oke circu 33'. Po back to	lug on top ove pipe. ulation and ulled casim o 371'. Pu DTE 7-6-	l 19g 11ed

CACTUS CASING PULLING INC. DATE 6/27/73	HON 1102 202 W. BHOADWAY PL. DNE — OFFICE 505 D93-2362 MODILE 505 D93-7274 NITES 505 393-7949 TEXAS OPERATIONS HOUSTON — P. O. BOX 24116 PHONE 713 672-0531 MIDLAND — 402 1ST NAT'L. BANK BLDG. PHONE 915 683-1839
CEMENTING AFFIDAVIT	
CONPANY Ala - Redden Oil 6.	
LEASE Billion 90 #1	
SECTION 14 TOWNSHIP 95 RANGE 37E COUNT	y Les M. M.
	<u></u>
12.37 FT. OF $44/2$ CASING RECOVERED	
FT. OF CASING RECOVERED	
PLUGS SET	
1. CIEF WACKS CEMENT SET AT 4950 FT	IO FT.
2. <u>35</u> SACKS CEMENT SET AT <u>1233</u> FT	TO FT.
3. 35 SACKS CEMENT SET AT 4271 FT	TO FT.
4. 10 SACKS CEMENT SET AT TOP FT	TO FT.
5. SACKS CEMENT SET AT FT	
6. SACKS CEMENT SET AT FT	TO FT.
7. SACKS CEMENT SET AT FT	
3. SACKS CEMENT SET AT FT	
	1.
CACTUS CASING	PULITING, INC.
SIGNED	Aninu
TITLE	<u>un .</u>