

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.	30-025-24933
5. Indicate Type of Lease	STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No.	K-2859

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Lease Name or Unit Agreement Name New Mexico "4"
2. Name of Operator Whiting Petroleum Corporation	8. Well No. 2
3. Address of Operator 1700 Broadway, Suite 2300, Denver, Colorado 80290	9. Pool name or Wildcat Flying "M" San Andres
4. Well Location Unit Letter <u>P</u> : <u>860</u> Feet From The <u>East</u> Line and <u>660</u> Feet From The <u>South</u> Line Section <u>4</u> Township <u>10th S</u> Range <u>33E</u> NMPM Lea County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 4257 GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data	
NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
OTHER: <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
	CASING TEST AND CEMENT JOB <input type="checkbox"/>
	OTHER: <input type="checkbox"/>

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 8/21/91 MIRU Pride Petroleum Services. Pulled & Laid down rods & pump. Pulled tbq. Set 4 1/2" CIBP @ 4410' w/3 sx cmt on top. Run Tbg & circulate hole with mud. Cut csg w/wireline at 1304'.
- 8/22/91 Pulled & laid down 29 jts 4 1/2" csg. Run tbq to 1357'. Circulate hole w/mud and spot 35 sx plug. WOC 4 hrs & tag plug @ 1207'. Run tbq to 429' and spot 40 sx plug.
- 8/23/91 Tag plug at 296'. Set 10 sx plug @ surface. Weld plate on csg & install dry hole marker. Cleaned location. RDMO. Plugging witnessed by NMOCD representative.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bruce Williams TITLE Staff Petroleum Engineer DATE 9/13/91
TYPE OR PRINT NAME G. Bruce Williams TELEPHONE NO. 303-837-1661

(This space for State Use)

APPROVED BY Jack Griffin TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY: