

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease  
State ☒ Fee ☐  
5. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL, TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT - (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator BTA OIL PRODUCERS	8. Farm or Lease Name Penn, 7504 JV-D
3. Address of Operator 104 South Pecos Midland, Texas 79701	9. Well No. 1
4. Location of Well UNIT LETTER "I" 2080 FEET FROM THE South LINE AND 560 FEET FROM THE East LINE, SECTION 7 TOWNSHIP 12-S RANGE 33-E NMPM.	10. Field and Pool, or Wildcat Bagley, North (Penn)
15. Elevation (Show whether DF, RT, GR, etc.) 4293' GL	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input checked="" type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Before Setting any plugs notify NMOCC.
2. Between All plugs 9.5#/gal. Mud.
3. Set 5-1/2" CIBP @ 9400' w/35sx cmt on top.
4. Set 5-1/2" CIBP @ 8700' W/3 sx cmt on top.
5. Cut & recover 5-1/2" csg. T/C @ 6630'.
6. Set 355 sx cmt plug in & out of 5-1/2" stub.
7. Set 40 sx cmt from 5100' to 5200' (Top of Glorietta 5150').
8. Set 40 sx cmt from 3675' to 3775' (Base of 8-5/8" @ 3725').
9. Cut & recover 8-5/8" csg. T/C ?
10. Set 55 sx cmt in & out of 8-5/8" stub.
11. Set 75 sx cmt 370' to 470' (Base of 12-3/4" csg @ 380').
12. Set 10 sx cmt @ Surface.
13. Install Dry Hole Marker.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Bob K. Newland BOB K. NEWLAND TITLE Regulatory Supervisor DATE 10/13/77

APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE \_\_\_\_\_

CONDITIONS OF APPROVAL, IF ANY:

Expires 4/17/78