

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>	
5. State Oil & Gas Lease No.	
7. Unit Agreement Name	
8. Farm or Lease Name Phillips-State	
9. Well No. 1	
10. Field and Pool, or Wildcat Wildcat	
12. County Lea	

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>
2. Name of Operator Charles F. Harding
3. Address of Operator 4312 Oak Lawn Avenue, Dallas, Texas, 75219
4. Location of Well UNIT LETTER <u>J</u> , <u>2310</u> FEET FROM THE <u>South</u> LINE AND <u>2248</u> FEET FROM THE <u>East</u> LINE, SECTION <u>3</u> TOWNSHIP <u>9-S</u> RANGE <u>32-E</u> NMPM.
15. Elevation (Show whether DF, RT, GR, etc.) 4416 GR

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:	SUBSEQUENT REPORT OF:
PERFORM REMEDIAL WORK <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>
OTHER <input type="checkbox"/>	OTHER <input type="checkbox"/>
PLUG AND ABANDON <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
CHANGE PLANS <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1. Set CIBP @ 4167', top @ 4165'. Ran dump bailer w/5 sax. Spotted 35' cement plug from 4130-4165'.

2. Ran tbg. to 4100' & circulated hole with mud.

3. Shot 4½" csg. @ 3004'. Pulled & lay down 74 jts. (2998') 4½" csg. Ran tbg. to 3054' & circ. hole with mud. Pump 40 sax. plug. Pull 25 jts. tbg. 9-21-78.

4. 9-22-78. Run tbg. & check top of plug @ 2920. 40 sax. 2920-3054'.

5. Pulled tbg. to 1790'. Spot 35 sax. plug 1690-1790'.

6. Pulled tbg. Cut off head. Pump 10 sax. plug in surface. Placed top marker. Rig down & move off 9-22-78.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED H. C. Boatright TITLE Agent DATE 10-2-78

APPROVED BY [Signature] TITLE OIL & GAS INSPECTOR DATE JUN 30 1980

CONDITIONS OF APPROVAL, IF ANY: