

CONSERVATION DIVISION

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

5a. Indicate Type of Lease	
State ☐	Fee ☒
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT - II" (FORM C-101) FOR SUCH PROPOSALS.)

OIL WELL ☒	GAS WELL ☐	OTHER ☐
Name of Operator Alpha Twenty-One Production Company		
Address of Operator P.O. Box 1206 Jal, New Mexico 88252		
Location of Well UNIT LETTER <u>P</u> <u>990</u> FEET FROM THE <u>South</u> LINE AND <u>330</u> FEET FROM <u>East</u> LINE, SECTION <u>23</u> TOWNSHIP <u>11-South</u> RANGE <u>32-East</u> NMPM.		

7. Unit Agreement Name
8. Farm or Lease Name Rae
9. Well No. 1
10. Field and Pool, or Wildcat Pennsylvania
11. Elevation (Show whether DF, RT, GR, etc.) 4335.8 GR
12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

FORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐
TEMPORARY ABANDON ☐	CHANGE PLANS ☐
ALTER CASING ☐	OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐	ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
CASING TEST AND CEMENT JOBS ☐	OTHER <u>Try new zone---Pennsylvanian</u> ☒

Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1109.

- 1-13-83 Rig up unit.
- 1-14-83 Set CIBP at 10,188 feet by Welex to seal perforations at 10,218-10,230. Dumped 4 sacks of Class "C" cement (35') on top of CIBP at 10,188'.
- 1-15-83 Perforate the Pennsylvania at 9688, 9689, 9690, 9691, 9692, 9693, 9694, 9695 and 9696. (9 shots total). Run tubing in hole with a Halliburton RBP and RTTS. Set RBP at 9770.
- 1-16-83 Acidize with 3100 gals. of 15% NEFE. Flow back and then swab.
- 1-18-83 Swabbed dry. Release RBP at 9770 and come up the hole and set RBP at 9561. Pull tubing. Perforate Pennsylvania at 9479, 9480, 9481, 9482, 9488, 9490, 9491, 9496, 9498, 9500, 9502, 9519, 9520, 9521 (14 shots total). Run tubing and RTTS in hole.
- 1-19-83 Acidize with 4000 gals. of 15% NEFE. Flow back and then swab.
- 1-20-83 Swab and then pull RBP at 9561 and RTTS out of hole.
- 1-21-83 Put well on pump.
- 1-22-83 Rig down unit.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

by Michael D. O'... TITLE Drilling Superintendent DATE 1-10-83

by Elli... TITLE OIL & GAS INSPECTOR DATE JAN 14 1983

CONDITIONS OF APPROVAL, IF ANY: