

L CONSERVATION DIVISIO

P. O. BOX 2088

SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-77

NO. OF COPIES RECEIVED		
DISTRIBUTION		
SANTA FE		
FILE		
U.S.G.S.		
LAND OFFICE		
OPERATOR		

5a. Indicate Type of Lease

State ☒ Fee ☐

5. State Oil & Gas Lease No.

K-169

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER- <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Spence Energy Company	8. Farm or Lease Name Patton "5" State
3. Address of Operator 4849 Greenville Avenue, #381, Dallas, Texas 75206	9. Well No. 1
4. Location of Well UNIT LETTER <u>L</u> <u>660</u> FEET FROM THE <u>West</u> LINE AND <u>1980</u> FEET FROM THE <u>South</u> LINE, SECTION <u>5</u> TOWNSHIP <u>9S</u> RANGE <u>32E</u> NMPM.	10. Field and Pool, or Wildcat Wildcat
15. Elevation (Show whether DF, RT, GR, etc.) 4413GL 4423 KB	12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <u>Completion attempts & plug back operations</u> <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 4/5 Set CIBP @ 4300', perf San Andres from 4206'-4212' with one jet shot per foot. Acidize w/1000 gallons 7½% HCl. Swab back formation water. Set CIBP @ 4180'.
- 4/6 Perf San Andres (Upper Slaughter Zone) from 4146' to 4166' with one jet shot per foot. Acidize w/1000 gallons 7½% HCl. Swabbed dry, reacidized with 3000 gallons 15% HCl. Swabbed dry, no shows. Hole dry in all zones attempted. Shot off 5½" casing @ 3505', pulled
- 4/9 Notified State of intent to P&A, & permission obtained. State witnessed plugging operation. Set 100' cmt. plug in mud laden hole at 4090' to 4190'. Set 100' cmt. plug from 3455' to 3555' (50' in & out 5½" csg. stub). Set 100' cmt plug from 3324' to 3424' (50' in & out of 8-5/8" csg at 3374') Set 150' cmt. plug in 8-5/8" csg. across top of salt (Top of salt 1754 Set 10 sxs plug at surface & installed dry hole marker.
- 6/1 Charles Lease Service Tatum, roads bladed, pits filled & levelled, location levelled & clear of junk.

8. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED M. C. Stator TITLE Exploration Manager DATE June 1, 1983
 M. C. Stator
 Paul Kautz
 Geologist
 APPROVED BY _____ TITLE _____ DATE 4 Jan 84