

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION

P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO. 30-025-27922
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Santa Fe VC
8. Well No. 1
9. Pool name or Wildcat West Sawyer San Andres
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3975.6' GR

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☐ GAS WELL ☐ OTHER P & A Well

2. Name of Operator
YATES PETROLEUM CORPORATION

3. Address of Operator
105 South 4th St., Artesia, NM 88210

4. Well Location
Unit Letter G : 1650 Feet From The North Line and 2310 Feet From The East Line

Section 8 Township 10S Range 37E NMPM Lea County

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>		CASING TEST AND CEMENT JOB <input type="checkbox"/>	
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged and abandoned well as follows: Plugging procedures began on July 13, 1993.

POOH with tubing. RIH w/4-1/2" bridge plug and set at 4900'. POOH. RIH w/tubing to 4899'. Circulated hole with mud. Spotted a 15 sack cement plug on top of bridge plug. POOH with 57 stands and laid down remainder of tubing in hole. Nipped down 4-1/2" wellhead. Free point casing. Free at 2140'. Worked casing up and down. Re-free pointed casing at 2440'. Shot 4-1/2" casing at 2447'. Pulled and laid down 61 joints of casing. Weld on 7" pull nipple. Cut plate off 7" casing. Free pointed casing. Shows to be free at 700'. Rigged up casing jacks to work casing. Attempted to recover 700' by working with jacks. Casing shows to be free at 600'. Rigged up wireline and back off shot. Unable to back off casing at 589'. Ran 2nd shot to 589'. Casing backed off. COOH with casing. Had 429'. Laid down 7" casing. Ran tubing to 2950'. Spotted 140 sacks cement to cover base of salt at 2870' and 4-1/2" stub at 2447' and 7" casing shoe at 2093'. POOH & WOC. Tagged top of cement at 1995'. POOH.

CONTINUED ON NEXT PAGE

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rusty Klein TITLE Production Clerk DATE August 1, 1993

TYPE OR PRINT NAME Rusty Klein TELEPHONE NO. 505/748-1471

(This space for State Use)

APPROVED BY Jack Griffin TITLE DATE

CONDITIONS OF APPROVAL, IF ANY: