

STATE OF NEW MEXICO
ENERGY AND MINERALS DEPARTMENT

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

OIL CONSERVATION DIVISION

P. O. BOX 2088
SANTA FE, NEW MEXICO 87501

Form C-103
Revised 10-1-79

5a. Indicate Type of Lease
State ☒ Fee ☐

5. State Oil & Gas Lease No.
LG--5218

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Lundberg Operating Company	8. Farm or Lease Name State 36
3. Address of Operator 545 Upper North Broadway, Corpus Christi, Texas 78476	9. Well No. 1
4. Location of Well UNIT LETTER <u>F</u> 1980 FEET FROM THE <u>North</u> LINE AND 1980 FEET FROM THE <u>West</u> LINE, SECTION <u>36</u> TOWNSHIP <u>9S</u> RANGE <u>37E</u> NMPM.	10. Field and Pool, or Wildcat Sawyer (San Andres Assoc.)
11. Elevation (Show whether DF, RT, GR, etc.) 3946.9 Ground	12. County Lea

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐ CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOBS ☐

OTHER ☐

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4/27/88—Move in and rig up PBCP Rig No. 3. Unseat rod pump. Pull out of hole with 194 rods and pump. Unseat tubing anchor and spot 30 sk cement plug across perforations at 4928' SDON.

4/28/88—Run in hole with tubing to tag plug—no plug. Spot 15 sk cement across perfs and pulled 5 strands. Load and circulate hole with salt gel. Pull out of hole with tubing. Run in hole with wireline and tag plug across perfs at 4800'. Perforate casing at 2070'. Spot 35 sk cement across 8-5/8" shoe at 2115'. SDON.

4/29/88—Tag plug at 1710' with wireline. Shot 5-1/2" casing at 580' and 502'. Pull out of hole with 13 joints 5-1/2" casing. Spot 35 sk plug across stab. Wait on cement. Tag plug at 420'. Spot 10 sk plug at surface. Cap well and erect dry hole marker. Rig down.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED C. O. Lundberg TITLE President DATE 6/18/88

ORIGINAL SIGNATURE OF OPERATOR
DISTRICT OFFICE

APPROVED BY _____ TITLE _____ DATE _____

CONDITIONS OF APPROVAL, IF ANY:

E