

ROSWELL DISTRICT COPY

Form 9-331
(May 1963)

UNITED STATES DEPARTMENT OF THE INTERIOR GEOLOGICAL SURVEY

SUBMIT IN TRIPL. FE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		5. LEASE DESIGNATION AND SERIAL NO. NM - 56262	
2. NAME OF OPERATOR TXO Production Corp.		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR 900 Wilco Building		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 660' FSL & 660' FEL		8. FARM OR LEASE NAME Price Federal	
14. PERMIT NO.		9. WELL NO. 1	
15. ELEVATIONS (Show whether DF, RT, GM, etc.) 4294.2' GL		10. FIELD AND POOL, OR WILDCAT Vada Penn	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Sec 5, T-9-S, R-34-E	
		12. COUNTY OR PARISH Lea	
		13. STATE NM	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF ☐	PULL OR ALTER CASING ☐	WATER SHUT-OFF ☐	REPAIRING WELL ☐
FRACTURE TREAT ☐	MULTIPLE COMPLETE ☐	FRACTURE TREATMENT ☐	ALTERING CASING ☐
SHOOT OR ACIDIZE ☐	ABANDON* ☐	SHOOTING OR ACIDIZING ☐	ABANDONMENT* ☒
REPAIR WELL ☐	CHANGE PLANS ☐	(Other) ☐	

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

1. Load hole w/ 9# brine wtr. Inst BOP.
2. Set CIBP w/ 35' cmt @ 9585'. Tag.
3. Set 100' cmt plug from 8995-8895'. (15 sx).
4. Set 100' cmt plug from 7848-7948'. (15 sx).
5. Set 100' cmt plug from 7638-7738'. (15 sa).
6. Free pt., cut and pull 5 1/2" csg.
7. Set 100' cmt plug 50' in and out of Stub. (30 sx). Tag.
8. Set 100' cmt plug from 5284-5384'. (35 sx).
9. Set 100' cmt plug from 3950-4050'. (50 sx). [This is 50' in and out of 8 5/8" csg].
10. Set 100' cmt plug from 2619-2719'. (50 sx).
11. Set 100' cmt plug from 450-550'. (50 sx).
12. Set ~~10~~ at surface plug = 50'
13. Set marker. Fill pits. Clean location.

ACCEPTED FOR RECORD

JUL 31 1987

SJS

CARISBAD, NEW MEXICO

RECEIVED
SEP 21 11 01 AM '83
BUREAU OF LAND MANAGEMENT
ROSWELL DISTRICT

18. I hereby certify that the foregoing is true and correct

SIGNED Deen Wood TITLE Production Engineer

(This space for Federal or State use)

APPROVED BY [Signature] TITLE DATE 9-16-83

CONDITIONS OF APPROVAL, IF ANY: