

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-101
Revised 1-1-85

DISTRICT I
P.O. Box 1960, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Azusa, NM 88210

DISTRICT III
1000 Auto Plaza Rd., Azusa, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL AP. NO. <u>28102</u> <u>30-025-28105</u>
5. Indicate Type of Lease STATE ☒ FEE ☐
6. State Oil & Gas Lease No. LC-1796-1

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)

1. Type of Well OIL ☒ GAS ☐ OTHER ☐	7. Lease Name or Unit Agreement Name State AR
2. Name of Operator Lynx Petroleum Consultants, Inc.	8. Well No. 4
3. Address of Operator P. O. Box 1979, Hobbs, NM 88241	9. Pool Name or Wildcat Echols (Devonian)
4. Well Location Unit Letter <u>K</u> : <u>1950</u> Feet From The <u>South</u> Line and <u>1650</u> Feet From The <u>West</u> Line Section <u>2</u> Township <u>11S</u> Range <u>37E</u> NMPM <u>Lea</u> County <u></u>	
10. Elevation (Show whether D.F., R.L.E., R.T., G.H., etc.) <u>3961' KB</u>	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMEDE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

4/6/91 RU.

4/8/91 Run bit and scraper to 11,300'. Pull tubing.

4/9/91 Run CIBP on wireline and set at 11,300'. Run tubing to 11,300'. Tag plug. Circulate mud. Spot 15 sxs cement at 11,300' on CIBP. Pull tubing to 7600'. Spot 25 sxs cement from 7600-7350'. Pull tubing out of hole.

4/10/91 Weld on lift nipple. RU jacks. Free point and cut casing at 3500'

4/11/91 Pull and lay down 80 jts. of 5½" casing. Run in hole with tubing to 3550'. Spot 30 sxs cement. POOH.

4/12/91 Tag plug at 3425'. Pull tbq. to 2200'. Spot 35 sxs cement from 2200-2095'. Pull tubing to 400'. Spot 35 sxs cement from 400-295'. Pull to 30' from surface. Circulate 10 sxs cement.

4/13/91 Cut off wellhead. Install marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Marc L. Wise TITLE President DATE 4/28/92

TYPE OF PRINT NAME Marc L. Wise

TELEPHONE NO. 505-392-6950

(This space for State Use) ORIGINAL SIGNED BY RAY SMITH

FIELD REP. H

MAY 11 '92

APPROVED BY _____ TITLE _____ DATE _____