

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. L-434

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:
OIL WELL ☒ GAS WELL ☐ OTHER ☐

2. Name of Operator
Coastal Oil & Gas Corporation

3. Address of Operator
P. O. Box 235, Midland, Texas 79702

4. Well Location
Unit Letter D : 660 Feet From The North Line and 660 Feet From The West Line
Section 4 Township 10-S Range 33-E NMPM Lea County

7. Lease Name or Unit Agreement Name
State "4"

8. Well No.
4

9. Pool name or Wildcat
Flying "M" (SA)

10. Elevation (Show whether DF, RKB, RT, GR, etc.)
4256' KB

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

- 2-21-89 RU Plugging Unit. LD rods, POOH with tbg. RU WL, set CIBP at 4380'. Dump 35' of cmt on CIBP (PBTD 4345'). TIH with tbg to 4250'. SDFN.
- 2-22-89 Circ hole with 10 PPG gelled brine. POOH with tbg. Pull stretch in 5-1/2" csg, calc free point at 1814'. RU WL, shoot collar at 2105', POOH with 48 jts. GIH with tbg to 2150', spot 35 sack plug, LD 50 jts tbg. SDFN.
- 2-23-89 GIH with tbg, tag cmt plug at 2048'. POOH to 1848' and spotted 35 sack plug (8-5/8" shoe at 1794'). WOC 4 hrs, TIH and tag plug at 1740'. POOH and LD tbg. Spot 10 sack surface plug.
- 2-24-89 Install P&A marker, cut anchors and clean location.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Bobby L. Smith TITLE Area Superintendent DATE 2-27-89
TYPE OR PRINT NAME Bobby L. Smith TELEPHONE NO. _____

(This space for State Use)

APPROVED BY Jack Griffin OIL & GAS INSPECTOR DATE MAR 7 1989
CONDITIONS OF APPROVAL, IF ANY: _____

✓
R N

E