

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.

30-025-29112

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

Battles

8. Well No.

1

9. Pool name or Wildcat

Vada Penn

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☒

GAS
WELL ☐

OTHER

2. Name of Operator

M & G Oil, Inc.

3. Address of Operator

P.O. Box 357 Crossroads, New Mexico 88114

4. Well Location

Unit Center H : 1980 Feet From The North Line and 510 Feet From The East Line

Section 7 Township 9-S Range 36-E NMMPM Lea County

10. Elevation (Show whether DF, RKB, RT, GR, etc.)

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☒

REMEDIAL WORK ☐

ALTERING CASING ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☐

PULL OR ALTER CASING ☐

CASING TEST AND CEMENT JOB ☐

OTHER ☐

OTHER ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. SEE RULE 1103.)

1. Mix and pump 100 sacks cement through tubing and displace with salt gel mud. Wait on cement. Pressure tubing to 1000# to assure plug is holding.
2. Cut tubing above collapsed point at approximately 8500' depth.
3. Spot 35 sacks cement through tubing at cut point. Pull out of hole with tubing.
4. Check top of cement with sinker bar on sand line to assure minimum of 100' of cement fill above cut point of tubing.
5. Salvage 5 1/2" casing from free point.
6. Spot 100' cement plug through tubing from 50' below top of 5 1/2" casing stub. Pull out of hole with tubing. Tag top of cement.
7. Spot 100' cement plug through tubing straddling 8 5/8" casing shoe. Tag top of plug.
8. Spot 100' cement plug through tubing straddling top of salt section at 2100'.

I hereby certify that the information above is true and complete to the best of my knowledge and belief

SIGNATURE

TITLE

President

DATE 7-12-89

TYPE OF PRINT NAME

TELEPHONE NO.

(This space for State Use)

**ORIGINAL SIGNED BY JERRY SEXTON
DISTRICT I SUPERVISOR**

APPROVED BY

TITLE

DATE

AUG 4 1989

CONDITIONS OF APPROVAL IF ANY:

THE COMMISSION MUST BE NOTIFIED 24
HOURS PRIOR TO THE BEGINNING OF
PLUGGING OPERATIONS FOR THE C-103
TO BE APPROVED.

RECEIVED
JUL 18 1989
OCD
HOBBS OFFICE