

M & G Oil, Inc. --- Battles No. 1

9. Salvage 8 5/8" casing from free point. Spot 100' cement plug through tubing from 50' below top of 8 5/8" casing stub. Tag top of cement.
10. Spot 100' cement plug through tubing straddling 13 3/8" casing shoe. Tag top of cement.
11. Spot 50' cement plug in top of 13 3/8" casing.
12. Erect dry hole marker.
13. Fill mud pits and cellar and clean and level location.

NOTE NO. 1--Pumped 75 BFW down tubing on 6-23-89 to assure tubing is open. Had vacuum on tubing at end of pumping.

NOTE NO. 2--Hole to be loaded with salt gel mud between all plugs.