

OIL CONSERVATION DIVISION
P O BOX 2088
SANTA FE, NEW MEXICO 87501

30-025 30919

Form C-103
Revised 10-1-78

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.O.S.	
LAND OFFICE	
OPERATOR	

5a. Indicate Type of Lease	
State ☐	Fee ☒
5. State Oil & Gas Lease No.	

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER		7. Unit Agreement Name
2. Name of Operator Bright and Company		8. Farm or Lease Name Cook "A"
3. Address of Operator 2911 Turtle Creek Blvd., Suite 700, Dallas, Texas 75219		9. Well No. #1
4. Location of Well NE 1/4 SECTION 0 660 FEET FROM THE South LINE AND 1930 FEET FROM East LINE, SECTION 31 TOWNSHIP 9S RANGE 34E NMPM.		10. Field and Pool, or WHdca Undesignated Abo
15. Elevation (Show whether DF, RT, GR, etc.) 4261' GR 4272' KB		12. County Lea

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPS. ☐	PLUG AND ABANDONMENT ☒
PULL OR ALTER CASING ☐	OTHER ☐	CASING TEST AND CEMENT JOBS ☐	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

TD 9085'. PBD 9894'. TIH w/ 3 1/8" HC csg gun & perf Abo zone 8887-90', 8906-30' & 8936-39' w/ 3 JSPF (Total 93 holes). TIH w/ 1 jt TP, Otis Permalatch pkr, SN on 2 3/8" N-80 tbg & set pkr @ 8801'. RU HALCO. Acidized w/ 15,000 gals 20% NEFE acid using BS as a divertor. Swab load - 100% wtr. NS. P&A as per NMOCD procedure. TIH w/ jet cutter & shot off csg @ 4635'. LD csg. TIH w/ 2 3/8" tbg to 8792' & set 25 sx plug. Raised tbg & load hole w/ 10# salt gel mud. WOC. Tag plug @ 8529'. LD tbg to 5414' & set 25 sx cmt plug. LD tbg to 4668' & set 35 sx cmt plug. WOC. Tag plug @ 4522'. LD tbg to 4011' & set 45 sx cmt plug. WOC. Tag plug @ 3898'. LD tbg to 2011' & set 30 sx cmt plug. LD tbg. Remove 8 5/6" & 12 3/4" WH. Spot 10 sx surface plug. Set 4 1/2" OD dry hole marker. P&A witnessed by NMOCD Field Representative, Jack Griffin.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Tracy D. Jensen TITLE Engineer DATE 8/20/90

APPROVED BY [Signature] TITLE [Signature] DATE 1991

CONDITIONS OF APPROVAL, IF ANY: