Suomit 3 Copies to Appropriate District Office	State of New M Ene, Minerals and Natural F		Form C-103 Revised 1-1-89	
DISTRICT I P.O. Box 1980, Hobbe, NM 88240	OIL CONSERVATION DIVISION 310 Old Santa Fe Trail, Room 206 Santa Fe, New Mexico 87503		WELL API NO. 30-025-33899	
DISTRICT II P.O. Drawer DD, Artesia, NM 88210	Salita re, new mex	100 87505	5. Indicate Type of Lease STATE X FEE	
DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410			6. State Oil & Gas Lease No.	
SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)			7. Lease Name or Unit Agreement Name	
1. Type of Well: OIL WELL X WELL	OTHER	·.	State 16	
2. Name of Operator Cobra Oil & Gas Corporation			8. Well Na. 1	
3. Address of Operator			9. Pool name or Wildcat	
P.O. Box 8206 Wichita	P.O. Box 8206 Wichita Falls, Texas 76307-8206		Wildcat - Devonian	
4. Well Location Unit Letter P : 330	Free From The South	Line and99(Feet From TheEastLine	
Section 16			NMPM Lea County	
	10. Elevation (Show whether 3988 G			
II. Check A	Appropriate Box to Indicate 1	Nature of Notice, Re	port, or Other Data	
•• •			SEQUENT REPORT OF:	
	PLUG AND ABANDON	REMEDIAL WORK	ALTERING CASING	
TEMPORARILY ABANDON	CHANGE PLANS	COMMENCE DRILLING		
PULL OR ALTER CASING	_	CASING TEST AND CEN		
OTHER:		OTHER:		
12. Describe Proposed or Completed Operat	ions (Clearly state all pertinent details, a	und rive pertinent dates, inclu	ding estimated date of starting any proposed	

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Test 8 5/8" casing to 1000 psi for 15 minutes. Tests BOP's to 3000 psi. Run in hole w/7 7/8" bit. Hit bridge in 8 5/8" casing at 1214'. Clean out to 1382', getting formation, cement and metal returns. Appear to drill out of casing at 1382'. After contacting OCD, made attempt to reenter 8 5/8" casing. Pick up 7 3/4" OD flat bottom mill, milled to 1508' (114') in 4 hours. Mil was outside casing. Received OK from OCD in Hobbs, Charlie Parinea, to plug well. Spot 150 sacks C1 "C" plug at 1457'. Tag plug after WOC for 2 hours, top of plug 1382'. Set 2nd plug, 125 sacks C1 "C" @ 1382', WOC 2 hours, did not set up, POOH w/DP, full of cement. WOC 2 hours, RIH w/DP, tag plug at 963' (1382' - 963'). Cut off 13 3/8" and 8 5/8" casing 3' below ground level. Spot 25 sacks cement plug at surface. Weld plates on casing. Well P & A July 20, 1997.

I hereby certify that the information above is true and complete to the best of my knowle SKINATURE	MLE	Production Supervisor	DATE
TYPE OR PRINT NAME ROry Edwards		TELEPHONE NO.	940-716-5100
(This space for State Use)		COMPLIANCE OFFICER	MAIN 281 1
APPROVED BY JULY (Juli		f and the second	DATE