

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 30-025-34049
5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
6. State Oil & Gas Lease No. 21059

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Lease Name or Unit Agreement Name STATE 7
2. Name of Operator COBRA OIL & GAS CORPORATION	8. Well No. 1
3. Address of Operator PO BOX 8206	9. Pool name or Wildcat WILDCAT-DEVONIAN
4. Well Location Unit Letter <u>P</u> : <u>591</u> Feet From The <u>SOUTH</u> Line and <u>543</u> Feet From The <u>EAST</u> Line Section <u>7</u> Township <u>10S</u> Range <u>37E</u> NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3974' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

2/16/98 - Move in, rig up, run in hole with 2 7/8" tubing to 12,500', mix and pump 25 sacks Class "H" cement from 12,500'-12,300' in 5 1/2" casing. Pull out of hole with tubing to 10,000, SDFN. Run in with tubing and tag plug at 12,308' - pull out of hole with tubing, weld 5 1/2" pull nipple, SDFN. Rig up casing jacks, est free point \pm 4583', cut off casing at 4500', lay down 110 jts 5 1/2" casing. Run in hole with 2 7/8" tubing to 9100', mix and pump 25 sacks Class "C" cement from 9100' - 9000'. Pull up to 5700', mix and pump 25 sacks Class "C" cement from 5700' - 5600', 100 sacks Class "C" cement from 4550' - 4271', WOC 4 hours, tag plug at 4200', 35 sacks cement plug from 2200' - 2100', 35 sacks Class "C" cement from 554' - 454', 10 sacks Class "C" cement from 30' to surface. Set steel P&A marker.

Well plugged and abandoned 2/20/98.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rory Edwards TITLE Production Supervisor DATE 2-25-98
(940)
TYPE OR PRINT NAME Rory Edwards TELEPHONE NO. 716-5100

(This space for State Use)

APPROVED BY Jack Griffin TITLE OIL & GAS INSPECTOR DATE 2-25-98
CONDITIONS OF APPROVAL, IF ANY: