

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Bureau of Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
2040 Pacheco St.
Santa Fe, NM 87505

WELL API NO. 30-025-34255
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No. 22212
7. Lease Name or Unit Agreement Name HENARD UNIT
8. Well No. 1
9. Pool name or Wildcat GLADIOLA (DEVONIAN)

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)	
1. Type of Well: OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	
2. Name of Operator COBRA OIL & GAS CORPORATION	
3. Address of Operator PO BOX 8206, WICHITA FALLS, TX 76307	
4. Well Location Unit Letter <u>B</u> : <u>330</u> Feet From The <u>NORTH</u> Line and <u>2310</u> Feet From The <u>EAST</u> Line Section <u>26</u> Township <u>11S</u> Range <u>37E</u> NMPM LEA County	
10. Elevation (Show whether DF, RKB, RT, GR, etc.) 3923' GR	

11. Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐
OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☒
CASING TEST AND CEMENT JOB ☐
OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

1/15/98 - Wait on cement 12 hrs. Test 8 5/8" intermediate casing to 1000 psi for 15 min. Drill 7 7/8" hole to total depth of 12,656'. Run four drill stem tests, two had packer failures. Rig up Schlumberger, run open hole logs. Run in hole with drill pipe, set 30 sacks Cl "H" cement plug from 12,458'-12,358', set 30 sack Cl "H" plug from 11,300'-11,200', set 30 sack Cl "H" plug from 9214'-9114', set 30 sack Cl "C" plug from 7200'-7100', set 30 sack Cl "C" plug from 5912'-5812', set 50 sack Cl "C" plug from 4530'-4430', set 50 sack Cl "C" plug from 3100'-2900', set 25 sack Cl "C" plug from 2400'-2300', set 25 sack Cl "C" plug from 485'-385', set 25 sack Cl "C" plug from 33'-surface. Cut off wellhead, install dry hole marker.

Well plugged and abandoned 2/23/98.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Rory Edwards TITLE Production Supervisor DATE 3-3-98
(940)
TYPE OR PRINT NAME Rory Edwards TELEPHONE NO. 716-5100

(This space for State Use)

APPROVED BY

JOHN W. ROBINSON
OIL & GAS INSPECTOR

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

SEP 6 1998

516
62