

YATES PETROLEUM CORPORATION
East Sand Springs Unit #1
Section 5-T11S-R35E
Lea County, New Mexico

SUNDRY NOTICE CONTINUED:

3-15-2000 - Worked to unset RBP. Would not come loose. Get off RBP and POOH. TIH with short catch overshot, bumper sub and jars. Latched onto RBP and jarred for 2-1/2 hours. No progress - jars getting hot. Shut well in for night.

3-16-2000 - Tried to continue jarring on RBP but bumper sub quit stroking. Acts like sand has fallen in around overshot and bumper sub. Rigged up kill truck and tried to circulate around. Casing and tubing would only pressure up. Rigged up rotary wireline. Backed off at 12208' in the drill collars. Left overshot, bumper sub, jars and 1 3-1/8" drill collar looking up. Pulled 20 stands and shut down.

3-17-2000 - Finished POOH with tubing and collars. TIH with 3-7/8" shoe and washpipe. Washed over bottom hole assembly down to overshot on RBP. Circulate hole clean. POOH with shoe and washpipe. TIH with collar and tubing and screw back onto fish. Jarred on fish for 3 hours. Could not get overshot to turn loose. Shut well in for night.

3-18-2000 - Continued to jar on fish. Jars quit working. Rigged up Rotary Wireline. Backed off at 12208'. Left 1 3-1/8" drill collar sticking up. Rigged down Rotary Wireline. TIH with shoe and 2 joints of washpipe and jars to 9000'. Shut well in for night.

3-19-2000 - TIH with shoe and washpipe. Washed over fish and clean out to 12250'. Had 6' of fill. Circulate clean and pull above perforations with shoe. Shut well in due to high winds.

3-20-2000 - Dropped down with shoe and washpipe. Check for fill - no fill. POOH with shoe and washpipe. Picked up crossover sub, jars, 4 drill collars, accelerator and 2-3/8" P110 workstring. Shut well in for night.

3-21-2000 - TIH with 2-3/8" P110 workstring and assembly. Screwed into drill collar and jarred for 6 hours. Jars wore out. Shut well in for night.

3-22-2000 - Rigged up wireline. TIH with 1-11/16" OD freepoint tool. String free 23' into bottom drill collar. TOOH. TIH with 1-11/16" CCL with 2' string shot. Backed off at screw in sub. TOOH with tubing. Shut well in for night.

3-23-2000 - Picked up 3-13/16" shoe, 2 joints 3-13/16" washpipe, jars, 4 drill collars and 2-3/8" PH6 tubing. TIH and tagged top of fish. Rotated over and milled down 2' in 3 hours. Washed down to overshot. Cut 1' - shoe plugging up - barely touching fish. Shut down for night.

3-24-2000 - TOOH with shoe - shoe worn out. TIH with 3-7/8" overshot with 3-1/8" grapple, jars, drill collars and latched onto drill collar. Jarred 25 minutes. Fish parted. TOOH. Had bottom drill collar, jars, crossover and top sub of bumper sub. Shut well in for night.

3-25-2000 - TIH with 3-3/4" shoe, 1 joint 3-13/16" washpipe, jars, drill collars and PH6 tubing. Cut off 2' and fell 1'. Started plugging up - no torque. TOOH with same - had bumper sub and top connection of overshot. TIH with 3-13/16" shoe with 3" ID, 1 joint of washpipe, jars, drill collars to cut skirt of overshot and packer. Cut 1' and packer turned loose. Lost circulation. Went down 20'. Did not tag. TOOH. Had grapple and control guide in shoe.

3-26-27-2000 - TIH with 3-3/4" OD overshot with 1-3/4" grapple, bumper sub, jars, drill collars and tubing. Tagged packer at 12388'. Latched onto packer. Came up free. Went back down. Set down at 12398' (bottom of packer). TOOH - had all of RBP in overshot. Shut well in.

3-28-2000 - Laid down PH6 tubing. TIH with Arrow Set I RBP with index valve on 2-3/8" L-80 tubing to 11930'. Set packer. Loaded and tested to 1000 psi. Shut in.

3-29-2000 - TOOH with tubing. Rigged up wireline with full lubricator. TIH with 3-3/8" casing guns and perforated 11670-11886' w/48 .42" holes as follows: 11670-11676' and 11882-11886' (4 SPF - Atoka). TOOH with casing guns and rigged down wireline and lubricator. TIH with packer and tubing.

CONTINUED ON NEXT PAGE: