– Submit 3 Copies to Appropriate District Office	State of No. Energy, Minerals and Nati	ew Mexico ural Resources Department		Form C-103 Revised 1-1-89	
<u>DISTRICT 1</u> P.O. Box 1980, Hobbs, NM 88240	88240 OIL CONSERVATION DIVISION P.O. Box 2088		WELL API NO.	WELL API NO. 30-025-34859	
DISTRICT III P.O. Drawer DD, Artesia, NM 88210 DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410		· · · · · · · · · · · · · · · · · · ·	5. Indicate Type of Lease STATE STATE FEE		
		6. State Oil & Gas Lean	e No.		
SUNDRY NO	TICES AND REPORTS ON	N WELLS		-5606 ///////////////////////////////////	
(DO NOT USE THIS FORM FOR PF DIFFERENT RESE (FORM		EEPEN OR PLUG BACK TO A	7. Lease Name or Unit	Agreement Name	
I. Type of Well: OIL OL GAS WELL X WELL			Blitzen Al	B State	
2. Name of Operator YATES PETROLEUM CORPO	RATION	<u></u>	8. Well No. 2		
3. Address of Operator			9. Pool name or Wildca		
105 South 4th St., Ar 4. Well Location	tesia, NM 88210		Wildcat Dev	ronian	
Unit Letter ?80	00 Feet From The South	1 Line and8	50 Feet From The	East Line	
Section 16	Township 11S	Range 34E	NMPM Le	a County	
		whether DF, RKB, RT, GR, etc.)			
		4150' GR	Papart or Other Do	///////////////////////////////////////	
C 11.		CALE IN ALCOPENT INCOLUMN	Report of Other Da	LA CONTRACT	
	Appropriate Box to Indi		•	OBT OF	
	ITENTION TO:	SU	IBSEQUENT REP	L.	
			IBSEQUENT REP	ORT OF: ERING CASING	
	ITENTION TO:	SU		L.	
	ITENTION TO: PLUG AND ABANDON		IBSEQUENT REP		
	ITENTION TO: PLUG AND ABANDON	REMEDIAL WORK COMMENCE DRILL CASING TEST AND	IBSEQUENT REP	ERING CASING	
NOTICE OF IN ERFORM REMEDIAL WORK	ITENTION TO: PLUG AND ABANDON CHANGE PLANS	SL REMEDIAL WORK COMMENCE DRILL CASING TEST AND OTHER: Interme	BSEQUENT REP ALTI NG OPNS. PLU CEMENT JOB ediate casing & c cluding estimated date of start	ERING CASING	
NOTICE OF IN ERFORM REMEDIAL WORK	ITENTION TO: PLUG AND ABANDON CHANGE PLANS Tations (Clearly state all pertinent de D at 11:15 PM 2-15-2 4115.53') of casing Cemented with 950 2, weight 11.70). T eight 6.30). PD 1:0 WOC. Nippled up a 2000. WOC 27 hours	Commence Dailu Commence Dailu CASING TEST AND OTHER: Interme Doto: Ran 92 joint set at 4110'. Fi sacks Interfill C ailed in with 250 0 PM 2-16-2000. In and tested to 5000 and 15 minutes. In	ALT NG OPNS. PLU CEMENT JOB ediate casing & c cluding estimated date of start as of 9-5/8" 36# toat shoe set at 1/4#/sack floce sacks Premium P1 Bumped plug to 13 psi for 30 minut Reduced hole to 8	ERING CASING G AND ABANDONMENT ement ing any proposed (3216.94') and 4110'. Float 1e and 5#/sack us with 1% 50 psi, OK. es, OK. Drilled	
NOTICE OF IN ERFORM REMEDIAL WORK	ITENTION TO: PLUG AND ABANDON CHANGE PLANS TRAITORS (Clearly state all pertinent de D at 11:15 PM 2-15-2 4115.53') of casing Cemented with 950 2, weight 11.70). T eight 6.30). PD 1:0 WOC. Nippled up a 2000. WOC 27 hours DTE: Notified Sylvi	Adge and belief.	BSEQUENT REP ALT NG OPNS. PLU CEMENT JOB Ediate casing & c cluding estimated date of start as of 9-5/8" 36# Loat shoe set at 1/4#/sack floce sacks Premium Pl Sumped plug to 13 psi for 30 minut Reduced hole to 8 casing job.	ERING CASING G AND ABANDONMENT ement (3216.94') and 4110'. Float 1e and 5#/sack us with 1% 50 psi, 0K. es, 0K. Drilled -3/4". March 22, 2000	
NOTICE OF IN ERFORM REMEDIAL WORK EMPORARILY ABANDON ULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Ope work) SEE RULE 1103. TD 4110'. Reached TI 40# (898.59') (Total collar set at 4065'. gilsonite (yield 2.62 CaCl2 (yield 1.33, we Circulated 90 sacks. out at 4:15 PM 2–17–2 Resumed drilling. NO	ITENTION TO: PLUG AND ABANDON CHANGE PLANS TRAITORS (Clearly state all pertinent de D at 11:15 PM 2-15-2 4115.53') of casing Cemented with 950 2, weight 11.70). T eight 6.30). PD 1:0 WOC. Nippled up a 2000. WOC 27 hours DTE: Notified Sylvi	Adge and belief.	BSEQUENT REP ALT NG OPNS. PLU CEMENT JOB Ediate casing & c cluding estimated date of start as of 9-5/8" 36# Loat shoe set at 1/4#/sack floce sacks Premium Pl Sumped plug to 13 psi for 30 minut Reduced hole to 8 casing job.	ERING CASING G AND ABANDONMENT ement (3216.94') and 4110'. Float 1e and 5#/sack us with 1% 50 psi, OK. es, OK. Drilled	
NOTICE OF IN ERFORM REMEDIAL WORK EMPORARILY ABANDON ULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Ope work) SEE RULE 1103. TD 4110'. Reached TI 40# (898.59') (Total collar set at 4065'. gilsonite (yield 2.62 CaCl2 (yield 1.33, we Circulated 90 sacks. out at 4:15 PM 2–17–2 Resumed drilling. NO	ITENTION TO: PLUG AND ABANDON CHANGE PLANS TRAITORS (Clearly state all pertinent de D at 11:15 PM 2-15-2 4115.53') of casing Cemented with 950 2, weight 11.70). T eight 6.30). PD 1:0 WOC. Nippled up a 2000. WOC 27 hours DTE: Notified Sylvi	Adge and belief.	BSEQUENT REP ALT NG OPNS. PLU CEMENT JOB Ediate casing & c cluding estimated date of start as of 9-5/8" 36# Loat shoe set at 1/4#/sack floce sacks Premium Pl Sumped plug to 13 psi for 30 minut Reduced hole to 8 casing job.	ERING CASING G AND ABANDONMENT ement (3216.94') and 4110'. Float 1e and 5#/sack us with 1% 50 psi, 0K. es, 0K. Drilled -3/4". March 22, 2000	
NOTICE OF IN ERFORM REMEDIAL WORK EMPORARILY ABANDON ULL OR ALTER CASING OTHER: 12. Describe Proposed or Completed Ope work) SEE RULE 1103. TD 4110'. Reached TI 40# (898.59') (Total collar set at 4065'. gilsonite (yield 2.62 CaCl2 (yield 1.33, we Circulated 90 sacks. out at 4:15 PM 2–17–2 Resumed drilling. NO	ITENTION TO: PLUG AND ABANDON CHANGE PLANS TRAITORS (Clearly state all pertinent de D at 11:15 PM 2-15-2 4115.53') of casing Cemented with 950 2, weight 11.70). T eight 6.30). PD 1:0 WOC. Nippled up a 2000. WOC 27 hours DTE: Notified Sylvi	Adge and belief.	BSEQUENT REP ALT NG OPNS. PLU CEMENT JOB Ediate casing & c cluding estimated date of start as of 9-5/8" 36# Loat shoe set at 1/4#/sack floce sacks Premium Pl Sumped plug to 13 psi for 30 minut Reduced hole to 8 casing job.	ERING CASING G AND ABANDONMENT ement (3216.94') and 4110'. Float 1e and 5#/sack us with 1% 50 psi, 0K. es, 0K. Drilled -3/4". March 22, 2000	