Submit 3 Copies o Appropriate	State of New Me Energy, Minerals and Natural Re			Form C-103 Revised 1-1-89
District Office <u>DISTRICT I</u> 20. Bax 1980, Hobbs, NM 88240	OIL CONSERVATION DIVISION P.O. Box 2088		WELL API NO.	
DISTRICT II CO. Drawer DD, Artesia, NM 88210		Santa Fe, New Mexico 87504-2088		
DISTRICT III 1000 Rio Brazos Rd., Aziec, NM 87410		6. State Oil & Gas Lease No V-4834	r.	
DO NOT USE THIS FORM FOR FOR FOR	DTICES AND REPORTS ON WEL PROPOSALS TO DRILL OR TO DEEPEN SERVOR. USE "APPLICATION FOR PEF A C-101) FOR SUCH PROPOSALS.)	OR PLUG BACK TO A	7. Lease Name or Unit Agre	emeni Name
Type of Well: OIL GAS WELL WELL	X OTHER		East Sand S	orings Unit
Name of Operator YATES PETROLEUM CORP			8. Well No.	
Address of Operator 105 South 4th St., A		<u></u>	9. Pool name or Wildcat Wildcat Miss:	
. Well Location Unit LetterN :6 Section 24	Township 115 Ra 10. Elevation (Show whether	nge 34E DF, RKB, RT, GR, etc.)) Feet From The	West Line
	k Appropriate Box to Indicate I	3' GR Nature of Notice, R	eport. or Other Data	
	•••		SEQUENT REPOR	
NOTICE OF I	NTENTION TO:	506	SEQUENT HEF OF	
	PLUG AND ABANDON	REMEDIAL WORK	- · · ·	
				– –1
		REMEDIAL WORK	ALTERIA	
ERFORM REMEDIAL WORK	PLUG AND ABANDON CHANGE PLANS	REMEDIAL WORK COMMENCE DRILLIN CASING TEST AND C OTHER:	ALTERN GOPNS. PLUGA EMENT JOB	NG CASING
ERFORM REMEDIAL WORK EMPORARILY ABANDON JLL OR ALTER CASING THER: 2 Describe Proposed or Completed Of work) SEE RULE 1103. TD 13196'. Reached follows: 47 joints 17# P-110 varnished at 13196'. Float co set at 11276'. Cem (yield 2.77, weight 1#/cack salt and 3	PLUG AND ABANDON CHANGE PLANS C	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND C OTHER: Product d give periment dates, inclu Ran 317 joint blasted (1941.4 .33') of casing of marker set nterfill H, 1/4 00 sacks of Sup 13.0). PD 4:1	ALTERN ALTERN OPNS. PLUG A EMENT JOB ion casing & cemes ding estimated date of starting of s of 5-1/2" 17# c 8') and 270 joint set at 13196'. at 11297'. Bottoo #/sack flocele, 3 er H, .5% Halad 3 5 PM 4-17-2000.	NG CASING
ERFORM REMEDIAL WORK	PLUG AND ABANDON CHANGE PLANS CHANGE PLANS Perations (Clearly state all pertinent details, and TD at 9:30 AM 4-12-2000. of 5-1/2" 17# P-110 sand (11263.85') (Total 13205 ollar set at 13151'. Top ented with 450 sacks of I 11.5). Tailed in with 6 % HR7 (yield 1.65, weight tes, OK. WOC. Released on unit.	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND C OTHER: Product d give pertinent dates, inclu Ran 317 joint blasted (1941.4 .33') of casing of marker set nterfill H, 1/4 00 sacks of Sup 13.0). PD 4:1 rig at 9:15 PM	ALTERN ALTERN OPNS. PLUG A EMENT JOB ion casing & cemes ding estimated date of starting of s of 5-1/2" 17# c 8') and 270 joint set at 13196'. at 11297'. Bottoo #/sack flocele, 3 er H, .5% Halad 3 5 PM 4-17-2000.	NG CASING
ERFORM REMEDIAL WORK EMPORARILY ABANDON JLL OR ALTER CASING THER: 2 Describe Proposed or Completed O work) SEE RULE 1103. TD 13196'. Reached follows: 47 joints 17# P-110 varnished at 13196'. Float co set at 11276'. Cem (yield 2.77, weight 1#/sack salt and .3) 2325 psi for 2 minu casing with 2% KCL. Waiting on completi I hereby certify that the Information above in the other set of the State o	PLUG AND ABANDON CHANGE PLANS C	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND C OTHER: Product d give pertinent dates, inclu Ran 317 joint blasted (1941.4 .33') of casing of marker set nterfill H, 1/4 00 sacks of Sup 13.0). PD 4:1 rig at 9:15 PM	ALTERN ALTERN ALTERN ALTERN ACTIONS. PLUGA ion casing & cemes ding estimated date of starting of s of 5-1/2" 17# c 8') and 270 joint set at 13196'. at 11297'. Bottoo #/sack flocele, 3 er H, .5% Halad 3 5 PM 4-17-2000. 4-17-2000. NOTE:	NG CASING ND ABANDONMENT nt X any proposed asing as s of 5-1/2" Float shoe set m of marker /10% HR7 44, 4% CFR3, Bumped plug to Displaced
ERFORM REMEDIAL WORK EMPORARILY ABANDON JLL OR ALTER CASING THER: 2 Describe Proposed or Completed O work) SEE RULE 1103. TD 13196'. Reached follows: 47 joints 17# P-110 varnished at 13196'. Float co set at 11276'. Cem (yield 2.77, weight 1#/sack salt and .3) 2325 psi for 2 minu casing with 2% KCL. Waiting on completi SKONATURE	PLUG AND ABANDON CHANGE PLANS CHANGE STATE AND ADDRESS OF A STATE AND ADDRESS OF ADDRESS OF ADDRESS OF ADDRESS OF ADDRESS OF ADD	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND C OTHER: Product d give pertinent dates, inclu Ran 317 joint blasted (1941.4 .33') of casing of marker set nterfill H, 1/4 00 sacks of Sup 13.0). PD 4:1 rig at 9:15 PM	ALTERN ALTERN	NG CASING ND ABANDONMENT nt X any proposed asing as s of 5-1/2" Float shoe set m of marker /10% HR7 44, 4% CFR3, Bumped plug to Displaced
ERFORM REMEDIAL WORK EMPORARILY ABANDON JLL OR ALTER CASING THER: 2 Describe Proposed or Completed Or work) SEE RULE 1103. TD 13196'. Reached follows: 47 joints 17# P-110 varnished at 13196'. Float co set at 11276'. Cem (yield 2.77, weight 1#/sack salt and .3 2325 psi for 2 minu casing with 2% KCL. Waiting on completi SKONATURE	PLUG AND ABANDON CHANGE PLANS CHANGE ALL Pertiment details, and the second of 5-1/2" 17# P-110 sand (11263.85') (Total 13205) of 1ar set at 13151'. Top ented with 450 sacks of I 11.5). Tailed in with 6% HR7 (yield 1.65, weight tes, OK. WOC. Released on unit.	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND C OTHER: Product d give pertinent dates, inclu Ran 317 joint blasted (1941.4 .33') of casing of marker set nterfill H, 1/4 00 sacks of Sup 13.0). PD 4:1 rig at 9:15 PM	ALTERN ALTERN ALTERN ALTERN COPNS. PLUG A EMENT JOB ion casing & cemes ion casing & cemes ding estimated date of starting of s of 5-1/2" 17# c 8') and 270 joint set at 13196'. at 11297'. Bottoo #/sack flocele, 3 er H, .5% Halad 3 5 PM 4-17-2000. 4-17-2000. NOTE: Cechnician	NG CASING ND ABANDONMENT nt X any proposed asing as s of 5-1/2" Float shoe set m of marker /10% HR7 44, 4% CFR3, Bumped plug to Displaced
ERFORM REMEDIAL WORK EMPORARILY ABANDON JLL OR ALTER CASING THER: 2 Describe Proposed or Completed Or work) SEE RULE 1103. TD 13196'. Reached follows: 47 joints 17# P-110 varnished at 13196'. Float co set at 11276'. Cemu (yield 2.77, weight 1#/sack salt and .3: 2325 psi for 2 minu casing with 2% KCL. Waiting on completi SIGNATURE TYPE OF FRIMT NAME Rusty K1	PLUG AND ABANDON CHANGE PLANS CHANGE PLANS CHANGE PLANS CHANGE PLANS CHANGE PLANS CHANGE PLANS Chance of the state all pertinent details, and the state of the state all pertinent details, and the state of the state all pertinent details, and the state of the state all pertinent details, and the state of the state all pertinent details, and the state of the state all pertinent details, and the state of the state all pertinent details, and the state of the state all pertinent details, and the state of the state all pertinent details, and the state of the state	REMEDIAL WORK COMMENCE DRILLING CASING TEST AND C OTHER: Product d give pertinent dates, inclu Ran 317 joint blasted (1941.4 .33') of casing of marker set nterfill H, 1/4 00 sacks of Sup 13.0). PD 4:1 rig at 9:15 PM	ALTERIA ALT	NG CASING ND ABANDONMENT