


Submit 3 Copies To Appropriate District Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised March 25, 1999

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-025-35907
1. Type of Well: Oil Well ☐ Gas Well ☐ Other ☐ TA'd Well ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Concho Oil & Gas Corp.		6. State Oil & Gas Lease No.
3. Address of Operator 110 W. Louisiana Ste 410, Midland, TX 79701		7. Lease Name or Unit Agreement Name: SV Sundown State
4. Well Location Unit Letter <u>K</u> : <u>1800'</u> feet from the <u>South</u> line and <u>2310'</u> feet from the <u>West</u> line Section <u>14</u> Township <u>10S</u> Range <u>37E</u> NMPM County <u>Lea</u>		7. Well No. <u>3</u>
10. Elevation (Show whether DR, RKB, RT, GR, etc.) 3937' GL, 3952' DF, 3953.5' KB		9. Pool name or Wildcat <u>East Echols, SA</u> Wildcat San Andres

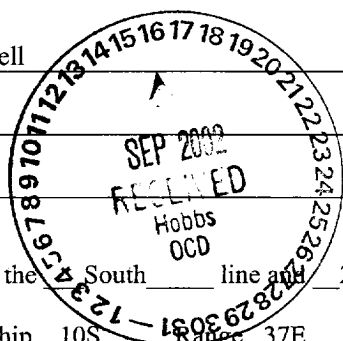

11. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data	
NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPLETION ☐ OTHER: ☐	SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ PLUG AND ABANDONMENT ☐ CASING TEST AND CEMENT JOB ☐ OTHER: Completion/TA'd Well ☒

12. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompilation.

7/29/02-MIRU Tyler WS Unit. RIH w/jts, tbg & tagged PBTD @ 5153'. LD jts, tbg bit @ 5063'. Circ hole. TOH w/jts.
7/30/02-RU pmp truck & WL. Ran GR/CCL/CBL. TOC @ 2290'. Perf San Andres from 5032'-5045' w/4" expd gun. PU pkr, XO, SN & TIH w/jts & tbg. Rev circ. ND BOP & NU tbg. Test & set pkr @ 4903'.
7/31/02-8/1/02-Swab well.
8/2/02-Unset pkr @ 4903'. TOH w/tbg. Perf San Andres from 5050'-5053' w/4" expd gun. Reset pkr @ 4903', test pkr to 500 psi-ok. Swab well.
8/3/02-Swab & shut well in for 40 hrs.
8/6/02-TOH w/jts, tbg & LD pkr. Ran 5 1/2" CICR & set @ 5047'. TIH w/tbg, jts & tag CICR @ 5047'. Circ hole. Mix & pmp 28 sxs C + additives. Spot cmt to end of tbg & sting into CICR. Pmp 1 bbl cmt around perfs & close annulus. Sqz 2 bbls cmt down & press to 2500 psi. Sting out CICR. Rvs tbg clean. REC 2 bbls cmt. Press tbg & csg to 2000 psi. TOH w/tbg.
8/7/02-TIH w/tbg & tag cmt @ 4870'. Drill out soft cmt from 4870'-4902' & drill out hard cmt from 4902'-5047'. Circ hole clean, test sqz to 2100 psi-ok. TOH w/tbg.
8/8/02-RU & re-perf San Andres from 5032'-5040' w/4" expd gun 2 SPF. TIH w/tbg. Set pkr @ 4903'. Test pkr to 500 psi-ok. Swab well.
8/9/02-Swab well. LD tbg, unset pkr & TOH. TIH w/pkr, SN & tbg.
8/12/02-Tagged PBTD @ 5047'. Set pkr @ 4903' & test to 500 psi-ok.
8/13-14/02-Swab well.
8/15/02-Unset pkr. TOH w/tbg. LD swab mandrel & pkr. TIH w/152 jts tbg. Set plug @ 4962', test to 500 psi-Ok. Circ hole w/130 BFW w/pkr fluid & 02 scav. TOH.
8/16/02-FNSH LD jts & setting tl. ND BOP. NU 2 7/8" 8rd B-1 flange & cap w/BP. RD & rls unit. Well TA'd.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE Dora Bustamante TITLE Production Analyst DATE 8/27/02
Type or print name Dora Bustamante Telephone No. (915) 683-7443

(This space for State use)
ORIGINAL SIGNED BY GARY W. WINK
APPROVED BY OC FIELD REPRESENTATIVE II/STAFF MANAGER DATE SEP 18 2002
Conditions of approval, if any: Temporary
Abandonment Expires 9/18/07