

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

FORM APPROVED
Budget Bureau No. 1004-0135
Expires: March 31, 1993

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to deepen or reentry to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals

5. Lease Designation and Serial No.

NM-0356

6. If Indian, Allottee or Tribe Name

7. If Unit or CA, Agreement Designation

8. Well Name and No.

Hayes Fed #4

9. API Well No.

32-241-0008-3

10. Field and Pool, or Exploratory Area

Allison Penn

11. County or Parish, State

Roosevelt, New Mexico

SUBMIT IN TRIPLICATE



1. Type of Well
☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator

M & W of Lovington, Inc.

3. Address and Telephone No.

Box 922; Lovington, NM 88260

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

2050' FSL 730' FWL

Unit L Sec. 30 T-8S R 37E

12. CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐ Notice of Intent

☒ Subsequent Report

☒ Final Abandonment Notice

TYPE OF ACTION

☒ Abandonment

☐ Recompletion

☐ Plugging Back

☐ Casing Repair

☐ Altering Casing

☐ Other

☐ Change of Plans

☐ New Construction

☐ Non-Routine Fracturing

☐ Water Shut-Off

☐ Conversion to Injection

☐ Dispose Water

(Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

12-14-95 Notified BLM. MIRU. POOH w/ rods, 4000'. NU BOP. Unable to release TAC. Pumped 70 bbls fresh water down backside.

12-15-95 Worked TAC, could not release. Made several attempts to fish rods, unsuccessful.

12-18-95 Continued fishing rods, no additional recovery. Worked tbq to 110,000#, tbq parted. Peter Chester of BLM gave ok to pump 100 sx cmt on fish.

12-19-95 POOH w/ remainder rods. Circulated hole w/ mud and pumped 100 sx C cmt @ 4900'. WOC and tagged @ 4175'.

12-20-95 RIH to 406', circulated hole w/ mud and pumped 60 sx C cmt. WOC and tagged @ 3840'. RIH to 423', circulated hole w/ mud and pumped 45 sx C cmt to 323'. POOH and LD tbq. RD BOP. Pumped 15 sx C cmt from 50' to surface.

12-21-95 Cut off wellhead, installed marker. Closed pit & leveled location.

14. I hereby certify that the foregoing is true and correct

Signed **(James F. Newman, P.E.)**


Title **Agent**

Date **12-22-95**

(This space for Federal or State office use)

Approved by _____
Conditions of approval, if any:

Title _____

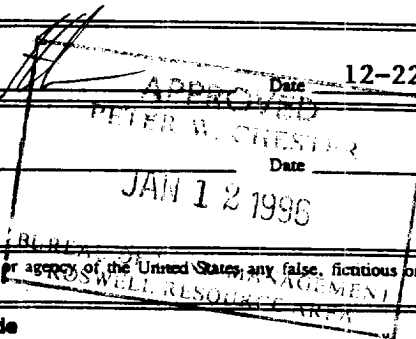

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

*See Instruction on Reverse Side

Plugging Report

C.H. Brockett

Hayes Fed #4

Roosevelt County, New Mexico

Job #1627

12-14-95 Thursday

POOH w/ 160 rods to 4000'. ND wellhead. NU BOP. Worked tbg several times, turn right 5" and 5" back. Worked several hours and waited on orders. Pumped 70 bbl fresh water down backside. SIFN.

RT: 8:00-5:00 9.0 hrs CRT: 9.0 hrs

12-15-95 Friday

Worked tbg anchor catcher, could not release. RIH w/ 160 rods, PU from ground. RIH to fish, catch or to fish and worked. PU 15,000#, pull off. POOH w/ broken fishing tool. RIH w/ rod fishing tool, latched on. PU 20,000#, pull off. Stacked out rods. SIW and SDFN.

RT: 7:00-4:30 9.5 hrs CRT: 18.5 hrs

12-18-95 Monday

Opened up well and RIH w/ rod, screwed on. PU on rods and jumped off fish. POOH w/ rods. SB. Lost fishing tool in hole. RIH w/ rods to screw onto fishing tool, worked rods. POOH, no fishing tool. Worked tbg to 110,000# as per C. H. Brockett. Tbg parted w/ 32,000#. Left in hole and called Peter Chester @ BLM. Gave OK to pump 100 sx cmt on fish. RIH w/ rods to 4000'. POOH w/ rods and began laying down. SIFN.

RT: 9:00-6:30 9.5 hrs CRT: 28.0 hrs

12-19-95 Tuesday

POOH w/ remainder rods [78 1"; 75 7/8"; 10 3/4"]. RD rod tools and worked tbg. POOH w/ 3 jts 2-7/8" tbg. RU pump truck and pumped 60 bbls brine. Waited on water. Circulated 100 bbls mud and pumped 100 sx C cmt @ 4900'. POOH w/ tbg, POOH w/ 13 standing, started pulling wet. POOH w/ tbg, SB 4000', LD rest (27 jts - cement up 2-7/8", 15 jts 2-3/8"). WOC. RIH w/ sandline and tag plug @ 4275'. POOH w/ sandline. RIH w/ tbg tongs, broke down. SIFN.

RT: 7:00-5:00 9.5 hrs CRT: 37.5 hrs

12-20-95 Wednesday

RIH w/ tbg to 4061' and pumped 60 sx C cmt, displacing to 3861'. SB 7 stds and LD rest of tbg. WOC. RIH w/ sandline and tagged plug @ 3840'. POOH w/ sandline. RIH w/ 7 stds to 423' and pumped 45 sx C cmt, displacing to 323'. POOH and LD tbg. RD BOP. Pumped 15 sx C cmt from 50' to surface. RDMO.

RT: 7:00-2:00 6.5 hrs CRT: 44.0 hrs

