

ORIGINAL DISTRICT COPY
Form 1-11
(May 1963)

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. <input type="checkbox"/> OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER		5. LEASE DESIGNATION AND SERIAL NO. LC 067192-A	
2. NAME OF OPERATOR American Petrofina Company of Texas		6. IF INDIAN, ALLOTTEE OR TRIBE NAME	
3. ADDRESS OF OPERATOR Box 1311, Big Spring, TX 79720		7. UNIT AGREEMENT NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface Unit K, 1980 FSL, 1980 FWL, Sec. 23		8. FARM OR LEASE NAME Federal "J"	
14. PERMIT NO.		9. WELL NO.	
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 4081 DF		10. FIELD AND POOL, OR WILDCAT Prairie Cisco South	
		11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA 23, T-8-S, R-36-E	
		12. COUNTY OR PARISH Roosevelt	
		13. STATE New Mexico	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

FRACTURE TREAT

SHOOT OR ACIDIZE

REPAIR WELL

(Other)

PULL OR ALTER CASING

MULTIPLE COMPLETE

ABANDON*

CHANGE PLANS

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING

ABANDONMENT* **XX**

(NOTE: Report results of multiple completion or well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

12-27-77 Set cast iron bridge plug at 9600' and dumped 3 sx. cement on top.
Set cast iron bridge plug at 9200' and dumped 3 sx. cement on top.
12-28-77 Loaded hole with mud laden fluid.
12-29-77 Cut 4-1/2" casing at 7500' but could not pull. Cut at 6260'
12-30-77 Pulled 169 jts. 4-1/2" csg. Ran 3600' of 2-7/8" tbg.
12-31-77 Ran tubing to 6290'
01-02-78 Pumped mud and set 50 sk cement plug at 6290'. After 3 hrs. tagged plug at 4235'. Set 50 sk plug at 4230'.
01-03-78 Tagged plug at 4060'. Set 35 sk cement plug at 2456'.
01-04-78 Shot 8-5/8" csg. at 1201, pumped mud and pulled csg.
01-06-78 Pumped 70 sk cement plug at 1260' and 70 sk plug at 530'. Waited on cement 3 hrs., but could not tag.
01-07-78 Pumped 150 sk plug at 530'. Waited 3 hrs. and checked plug with line at 331'. Set 90 sk cement plug at surface and installed 4" pipe marker.

NOTED

FEB 7 1978

BROWN

PTA 1-7-78

T.S. 9-78

18. I hereby certify that the foregoing is true and correct

SIGNED **J. C. Chapman**

Assistant District

TITLE **Manager of Production**

DATE **02-01-78**

(This space for Federal or State office use)

APPROVED BY **Peter M. Christ**

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

SEP 9 1981

FOR

JAMES A. GILHELY
DISTRICT SUPERVISOR

*See Instructions on Reverse Side

NOTED: BRYAN