

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☒ gas ☐
well well other

2. NAME OF OPERATOR

Dwight A. Tipton

3. ADDRESS OF OPERATOR

P. O. Box 755, Hobbs, NM 88241

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)

AT SURFACE: 554' FSL & 554' FEL of Sec. 13

AT TOP PROD. INTERVAL:

AT TOTAL DEPTH:

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☐
(other)

SUBSEQUENT REPORT OF:

☐
☐
☐
☐
☐
☐
☐
☒

5. LEASE

NM-060177

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Shearn Federal

9. WELL NO.

1

10. FIELD OR WILDCAT NAME

Allison Penn

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Sec. 13 T8S R36E

12. COUNTY OR PARISH 13. STATE

Roosevelt

NM

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

9/3/85 Pulled rods & pump, installed stripper head. Tubing open ended at 5035. Spotted 50 sack plug at 5035. Pulled 20 stands tubing.

9/4/85 Ran tubing, tag top of plug at 4765. Circulated hole with mud. Pulled tubing up to 4198 and spotted 25 sack cement plug. Pull tubing. Rig up Welex wire line & perf 2 holes at 2203 and 2 holes at 460. Ran tubing open ended to 2205, set packer at 2175 & squeezed 35 sacks cement into 8 5/8" & 5 1/2" casing. Pull tubing up to 470, set packer at 440 and squeeze 35 sacks into 8 5/8". Pull tubing, rerun 1 stand & circulate cement to surface. Pull tubing.

9/5/85 Dug out cellar, cut off wellhead, install marker, clean location. Location is ready for inspection.

Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED Peter W. Chester TITLE Agent DATE 10/24/85

APPROVED BY PETER W. CHESTER (This space for Federal or State office use) TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

NOV 8 1985

BUREAU OF LAND MANAGEMENT
ROSWELL RESOURCE AREA

*See Instructions on Reverse Side

RECEIVED

NOV 15 1985

O.C.D.
HOBBS OFFICE