

Submit 3 Copies
to Appropriate
District Office

State of New Mexico
Energy, Minerals and Natural Resources Department

Form C-103
Revised 1-1-89

DISTRICT I
P.O. Box 1980, Hobbs, NM 88240

DISTRICT II
P.O. Drawer DD, Artesia, NM 88210

DISTRICT III
1000 Rio Brazos Rd., Aztec, NM 87410

OIL CONSERVATION DIVISION
P.O. Box 2088
Santa Fe, New Mexico 87504-2088

WELL API NO.

5. Indicate Type of Lease

STATE ☐

FEE ☒

6. State Oil & Gas Lease No.

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A
DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT"
(FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well:

OIL
WELL ☐

GAS
WELL ☐

OTHER

Product Storage Well

2. Name of Operator

Oxy USA Inc. / Oxy NGL Inc.

3. Address of Operator

Bluitt Plant, Milnesand, N.M. 88125

7. Lease Name or Unit Agreement Name

Bluitt Gas Processing Plant

8. Well No.

9. Pool name or Wildcat

LPG storage well

4. Well Location

Unit Letter E : 2175 Feet From The N Line and 250 Feet From The W Line

SW/4 Section SW/4 14

Township T-8-S

Range R-36-E

NMPM

Roosevelt

County

10. Elevation (Show whether DP, RKB, RT, GR, etc.)

11.

Check Appropriate Box to Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐

PLUG AND ABANDON ☐

TEMPORARILY ABANDON ☐

CHANGE PLANS ☐

PULL OR ALTER CASING ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐

ALTERING CASING ☐

COMMENCE DRILLING OPNS. ☐

PLUG AND ABANDONMENT ☒

CASING TEST AND CEMENT JOB ☐

OTHER: ☐

12. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

Plugged Well - Start 10-26-89, Completed 11-3-89

1. Pulled 3" & 7" Casing out of well.
2. Set 9 5/8" CIBP @ 2240' with 150 Sks. of cement on top.
3. Loaded hole with mud and pressure tested 9 5/8" casing to 400 PSI.
4. Perforated 9 5/8" casing @ 350' and pumped into formation @ 400 PSI.
5. Pumped 140 sks. of cement - squeezed 75 sks. into formation, leaving 65 sks. of cement in 9 5/8" casing. Tagged top of cement @ 236'.
6. Set 10 sks. cement plug @ surface.
7. Install P & A Marker.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

Harlie Adams

TITLE

Plant Superintendent

DATE

11-9-89

TYPE OR PRINT NAME

Harlie Adams

TELEPHONE NO. 505-695-2311

(This space for State Use)

APPROVED BY

Jack Griffin

TITLE

OIL & GAS INSPECTOR

DATE

JAN 18 1990

CONDITIONS OF APPROVAL, IF ANY: