

NO. OF COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103
Supersedes Old
C-102 and C-103
Effective 1-1-65

5a. Indicate Type of Lease.
State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No.
K-2610

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.
USE "APPLICATION FOR PERMIT..." (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Tom L. Ingram	8. Farm or Lease Name State
3. Address of Operator P03 1757, Roswell, New Mexico 88201	9. Well No. 2
4. Location of Well UNIT LETTER E 1650 FEET FROM THE North LINE AND 990 FEET FROM THE West LINE, SECTION 32 TOWNSHIP 8S RANGE 38E NMPM.	10. Field and Pool, or Wildcat North Sawyer Devonian
15. Elevation (Show whether DF, RT, GR, etc.) 3972 GL	12. County Roosevelt

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>

SUBSEQUENT REPORT OF:

REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
CASING TEST AND CEMENT JOBS <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11-30- thru 12-7-74:

Unable to unseat packer. Pumped 100 sack cement plug to 8600 to cover perfs in casing. Backed off tubing @ 4260. Put 100' plug in and out of tubing and 5 1/2" casing 4300 to 4200. Put 100' plug in and out of base of 8-5/8" casing 4100 to 4000. Shot 8-5/8" casing @ 912 and pulled. Put 100' plug 928 to 828. Put plug 423-300 in and out of base of 13-3/8. Set 10 sack plug @ surface and dry hole marker. Mud laden brine used between all plugs.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Tom L. Ingram</u>	TITLE Operator	DATE 12/16/74
APPROVED BY <u>Eddie</u>	TITLE	DATE
CONDITIONS OF APPROVAL, IF ANY:		

OIL & GAS

42