

COPIES RECEIVED	
DISTRIBUTION	
SANTA FE	
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease State <input checked="" type="checkbox"/> Fee <input type="checkbox"/>
5. State Oil & Gas Lease No. K-2610

## SUNDRY NOTICES AND REPORTS ON WELLS

DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.

1. OIL WELL <input checked="" type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input type="checkbox"/>	7. Unit Agreement Name
2. Name of Operator Tom L. Ingram	8. Farm or Lease Name State
3. Address of Operator POB 1757, Roswell, New Mexico 88201	9. Well No. 1
4. Location of Well UNIT LETTER C 660 FEET FROM THE North LINE AND 1980 FEET FROM THE West LINE, SECTION 32 TOWNSHIP 8S RANGE 38E NMPM.	10. Field and Pool, or Wildcat North Sawyer Devonian
15. Elevation (Show whether DF, RT, GR, etc.) 3980 KB	12. County Roosevelt

Check Appropriate Box To Indicate Nature of Notice, Report or Other Data  
NOTICE OF INTENTION TO: SUBSEQUENT REPORT OF:

PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	OTHER <input type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

11/19/74 thru 11/30/74:

Set CIBP @ 11,300' with 35' cement plug on top. Shot 5½ csg. @ 4889 and pulled. Placed 100' cement plug @ 4939-4839 in and out of stub of 5½ csg. Put 100' cement plug 4260 - 4160 in and out of base of 8-5/8" csg. Shot 8-5/8" csg. @ 963' and pulled. Put 100' cement plug 1013 to 913 in and out of stub of 8-5/8" csg. Put 100' cement plug 453 to 353 in and out of base of 13-3/8". Put 10 sack plug @ surface and set marker. Mud laden brine used between all plugs.

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED <u>Tom L. Ingram</u>	TITLE <u>Operator</u>	DATE <u>12/4/74</u>
APPROVED BY <u>Ronald Castleberry</u>	TITLE <u></u>	DATE <u></u>
CONDITIONS OF APPROVAL, IF ANY:		

RECEIVED

DEC 5 1974

OIL CONSERVATION COMM.  
HOBBS, N. M.