	H.M. Oil Cone. Jivision		
Form 3160-5 June 1990)	DEPARTMENT	D STATES 1625 N. French Dr. OF THE INTERIOR HODDS, NM 8824C ND MANAGEMENT	FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993
	for proposals to drill of	ND REPORTS ON WELLS or to deepen or reentry to a different reservoir PERMIT-" for such proposals	6. If Indian, Allottee or Tribe Name
	7. If Unit or CA, Agreement Designation		
1. Type of Well Oil Gas Well Well 2. Name of Operator	8. Well Name and No. BLUITT SA FEDERAL #16		
PLAINS PETROLEUN 3. Address and Telephone No	9. API Well No. 30-041-10099		
415 W. WALL, SUITE	10. Field and Pool, or Exploratory Area		
4. Location of Welt (Footage, Sec., T., R., M., or Survey Description) 660' FSL & 660' FEL, Sec. 11 (P), T8S, R37E			Bluitt San Andres Associated
			11. County or Parish, State
			ROOSEVELT, NM
12. CHECK AP	PROPRIATE BOX(s) T	O INDICATE NATURE OF NOTICE, REPORT, C	OR OTHER DATA
TYPE OF S	UBMISSION	TYPE OF ACTION	
Notice of Inten	itent	X Abandonment	Change of Plans
-		Recompletion	New Construction
Subsequer	nt Report	Plugging Back	Non-Routine Fracturing
_		Casing Repair	Water Shut-Off
Final Aban	donment Notice	Altering Casing	Conversion to Injection
		Other	Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

1) run 2-3/8" 4.7# J55 EUE tbg work string open end w/mule shoe

2) guide 2-3/8" tbg through parted 4-1/2" OD csg @ 338' & 1621' and GIH OE to a depth of approximately 4500'

3) fill tbg, csg, csg-tbg and OH annulus w/10 ppg mud & establish circulation

4) mix, pump & spot 45 sx Premium plus cmt - leaving TOC @ about 4000' inside the 4-1/2" csg

5) pull tbg up to above 3000' from surface & leave cmt set minimum of 12 hrs and/or overnight

6) tag top of cmt plug w/OE tbg

7) through tbg, perf 4-1/2" csg above calculated top of cmt @ 3700'. Squeeze csg w/45 sx Prem Plus cmt, leave TOC inside 4-1/2" csg @ 2500'

8) POOH w/2-3/8" OE tbg to approx 1700' from surface, mix, pump & spot 200 sx Prem Plus plug from 1700' back to 875' from surface

9) POOH w/OE tog to 375' from surface, mix, pump & spot 100 sx Prem Plus cmt from 375' back to surface

- 10) cut off wellhead & 8-5/8"_csg, 4' below ground level, weld plate across the top of the 8-5/8" csg & install dry hole marker-14. I hereby certify that the foregoing is true and correct

SWW	*See instruction on Reve	erse Side
Title 18 U.S.C. Section 1001, makes it a crime statements or representations as to any matter	for any person knowingly and willully to make to an within its jurisdiction.	y department or agency of the United States any false, fictitious or fraudulent
Conditions of approval, if any:		MAR 1 2 2000
Approved by	Tille	Date
(This space for Federal or State office use)		
signed _ Bonnie Austrane	Title ADMIN. ASSIS	TANT Date03/06/00



MAR 0.8 2000 BLM ROSWELL, NM